

This anomaly list describes the known bugs, anomalies, and workarounds for the [ADIS16209](#).

Analog Devices, Inc., is committed, through future silicon revisions, to continuously improve silicon functionality. Analog Devices tries to ensure that these future silicon revisions remain compatible with your present software/systems by implementing the recommended workarounds outlined within this document.

PERFORMANCE ISSUES

Table 1. Anomalous Start-up Behavior [er001]

Background	The ADIS16209 uses a number of internal functions (accelerometer, A/D, D/A, I/O, clock, reference) to produce highly accurate tilt angles, with respect to gravity. Once the power supply level reaches +2.35 V, the ADIS16209 begins its power-on sequence to start each of these functions. The ADIS16209 uses an internal processor core and firmware to facilitate this power-on sequence.
Issue	On a small percentage of units that have Date Code 1233 (or lower), the start-up process occasionally exhibits behaviors that preclude correct inclinometer function and supply measurements. The observable symptoms include (but are not limited to) the following: <ul style="list-style-type: none"> SUPPLY_OUT < 1 V (when VCC = +3.0 V to 3.3 V) STATUS[0] = 1, indicating the low-supply error condition Incorrect XINCL_OUT, YINCL_OUT measurements
Workaround	Investigation of this phenomenon has found that the anomalous start-up behavior depends on external power supply configurations and the source impedance they present to the ADIS16209 . When experiencing these behaviors, review the application design for opportunities to lower the source impedance of the power supply (situational improvements in power trace routing and/or bypass have eliminated this behavior). Units that have a Date Code of 1234 (or higher) use firmware revision 1.5, which modifies the power-up sequence in a manner that improves its noise immunity during start-up. For units that have a Date Code of 1233 (or lower), all current inventory was updated to firmware revision 1.5, while shipments that came before this update have a firmware revision 1.4, which does not incorporate this modified power-on sequence. Note that the firmware revision resides in an undocumented register location, at Address 0x46 and uses an 8-bit, 2-digit binary digital code (BCD) format. Reading Address 0x46 returns a 16-bit number, which represents address locations 0x46 and 0x47. Mask off the upper 8-bits to eliminate the contents from Address 0x47 and use the remaining 8-bits to determine the firmware revision on an ADIS16209 . The lower nibble represents the tenths digit and the upper nibble represents the ones digit. For example, 0x14 would represent firmware revision 1.4, which indicates that the unit does not employ the updated power-on sequence. If this location contains the hexadecimal number of 0x15, then the unit uses firmware revision 1.5, which employs the modified power-on sequence.
Related Issues	None.

ANOMALY STATUS

Reference Number	Description	Status	Date Code
er001	Anomalous Start-up Behavior	Fixed	1234

Rev. 0

Information furnished by Analog Devices is believed to be accurate and reliable. However, no responsibility is assumed by Analog Devices for its use, nor for any infringements of patents or other rights of third parties that may result from its use. Specifications subject to change without notice. No license is granted by implication or otherwise under any patent or patent rights of Analog Devices. Trademarks and registered trademarks are the property of their respective owners.

NOTES

Компания «Океан Электроники» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Поставка оригинальных импортных электронных компонентов напрямую с производств Америки, Европы и Азии, а так же с крупнейших складов мира;
- Широкая линейка поставок активных и пассивных импортных электронных компонентов (более 30 млн. наименований);
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Помощь Конструкторского Отдела и консультации квалифицированных инженеров;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Поставка электронных компонентов под контролем ВП;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- При необходимости вся продукция военного и аэрокосмического назначения проходит испытания и сертификацию в лаборатории (по согласованию с заказчиком);
- Поставка специализированных компонентов военного и аэрокосмического уровня качества (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Actel, Aeroflex, Peregrine, VPT, Syfer, Eurofarad, Texas Instruments, MS Kennedy, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Компания «Океан Электроники» является официальным дистрибьютором и эксклюзивным представителем в России одного из крупнейших производителей разъемов военного и аэрокосмического назначения «JONHON», а так же официальным дистрибьютором и эксклюзивным представителем в России производителя высокотехнологичных и надежных решений для передачи СВЧ сигналов «FORSTAR».



JONHON

«JONHON» (основан в 1970 г.)

Разъемы специального, военного и аэрокосмического назначения:

(Применяются в военной, авиационной, аэрокосмической, морской, железнодорожной, горно- и нефтедобывающей отраслях промышленности)

«FORSTAR» (основан в 1998 г.)

ВЧ соединители, коаксиальные кабели, кабельные сборки и микроволновые компоненты:

(Применяются в телекоммуникациях гражданского и специального назначения, в средствах связи, РЛС, а так же военной, авиационной и аэрокосмической отраслях промышленности).



Телефон: 8 (812) 309-75-97 (многоканальный)

Факс: 8 (812) 320-03-32

Электронная почта: ocean@oceanchips.ru

Web: <http://oceanchips.ru/>

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, д. 2, корп. 4, лит. А