

PROPER USE GUIDELINES

Cumulative Trauma Disorders can result from the prolonged use of manually powered hand tools. Hand tools are intended for occasional use and low volume applications. A wide selection of powered application equipment for extended-use, production operations is available.

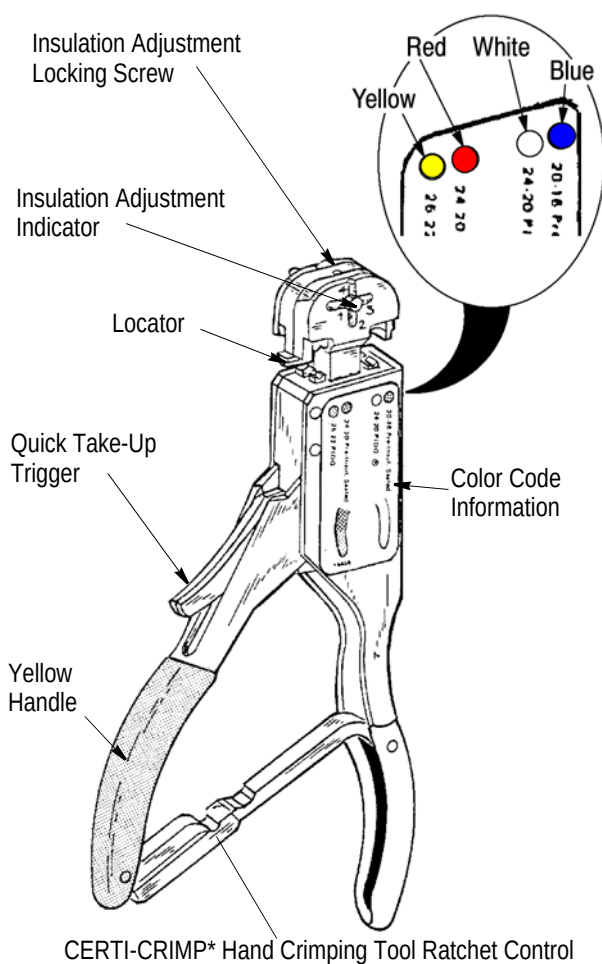



Figure 1

1. INTRODUCTION

This instruction sheet covers the use of "T"-HEAD Crimping Tools 59170, 59250, 59275, 59300, 69692-1, and 69693-1. See Figure 1. These tools crimp:

- PIDG* vinyl and nylon terminals and splices on stranded copper wire sizes 26 through 14.
- STRATO-THERM* terminals on stranded copper wire sizes 26 through 14.
- PIDG Insulation Restricting Nylon Terminals on stranded copper wire sizes 26 through 14.

- PIDG insulation restricting terminals with TEFLONT coating, used on stranded copper wire sizes 26 through 14.
- PIDG Radiation Resistant Terminals and Splices on stranded copper wire sizes 26 through 14.
- PLASTI-GRIP* Terminals on solid or stranded copper wire sizes 22 through 14.
- PLASTI-GRIP Butt Splices on solid or stranded copper wire sizes 26 through 22.
- Spare Wire Caps on solid or stranded copper wire sizes 22 through 14.



Dimensions on this sheet are in millimeters [with inch equivalent dimensions in brackets]. Figures and illustrations are for identification only and are not drawn to scale.

Reasons for reissue of this sheet are provided in Section 9, REVISION SUMMARY.

2. DESCRIPTION

The handles of the crimping tools are color-coded to match the color coding of the product to be applied.

The insulation adjustment indicator is used to control crimp height of the insulation barrel. It can be set at any of four positions corresponding to insulation diameter.

Tools also feature a locator, quick take-up trigger, and color code information.


The CERTI-CRIMP hand crimping tool ratchet control ensures full crimping of the product. Once engaged, the ratchet will not release until the handles have been FULLY closed.



The crimping dies bottom before the ratchet releases. This is a design feature that ensures maximum electrical and tensile performance of the crimp. Do NOT re-adjust the ratchet.

3. COLOR AND DOT CODING

Note that tool handles and terminal, splice and cap insulation are color coded for a given wire range as listed in Figure 2. Crimp the color coded terminal, splice or cap in the matching color coded portion of the tool. For example, when using Hand Tool 59275, yellow coded PIDG terminals and splices and red coded pre-insulated seated splices must be crimped in that portion of tool displaying the red and yellow coded dots and yellow handle. See Figure 1.

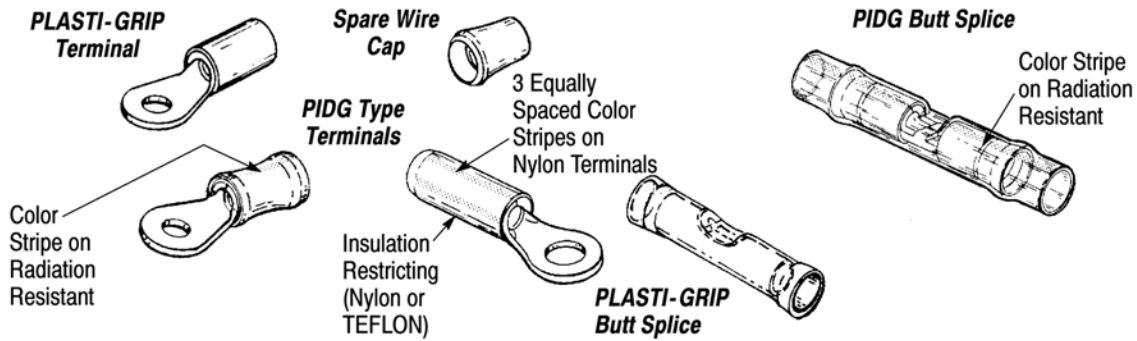

PRODUCT	TOOL NO. AND HANDLE COLOR CODE	DOT CODE	WIRE RANGE OR SIZE	WIRE INSULATION DIAMETER RANGE	INSULATION COLOR CODE	WIRE STRIP LENGTH			
						Terminals		Splices	
						Min.	Max.	Min.	Max.
PIDG INSULATION RESTRICTING NYLON TERMINALS MS 7928/1-1 through -10	59170 59250 RED AND BLUE	ONE DOT	26	0.66-1.40 [.026 - .055]	YELLOW W/3 BLACK STRIPES	6.35 [.25]	7.11 [.28]	—	—
			24	0.79-1.40 [.031 - .055]	YELLOW W/3 BLUE STRIPES				
PIDG TERMINALS MS 25036-143 through -147 (Class 1 Only)		ONE DOT	26 - 24	—	YELLOW	5.08 [.20]	5.84 [.23]	—	—
PIDG RADIATION RESISTANT TERMINALS MS 7928/4-143 through -147					NATURAL W/YELLOW STRIPE				
PIDG VINYL & NYLON TERM. OR SPLICE & 26-22 AWG PLASTI-GRIP BUTT SPLICE	59275 YELLOW AND WHITE	ONE DOT	26 - 22	—	YELLOW	4.06 [.16]	4.83 [.19]	4.32 [.17]	5.08 [.20]
		TWO DOTS	24 - 20	—	WHITE	4.83 [.19]	5.59 [.22]	5.59 [.22]	6.35 [.25]
PIDG VINYL AND NYLON TERMINALS AND SPLICES ALSO PLASTI-GRIP 22-16 AND 16-14 TERMINALS	59300 RED AND WHITE	TWO DOTS	24 - 20	—	WHITE	4.83 [.19]	5.59 [.22]	5.59 [.22]	6.35 [.25]
		ONE DOT	22 - 16	—	RED	5.08 [.20]	5.84 [.23]	6.35 [.25]	7.11 [.28]
	59170 59250 RED AND BLUE	ONE DOT	22 - 16	—	RED	5.08 [.20]	5.84 [.23]	6.35 [.25]	7.11 [.28]
		TWO DOTS	16 - 14	—	BLUE				
PIDG RADIATION RESISTANT TERMINALS AND SPLICES	59275 YELLOW AND WHITE	ONE DOT	26 - 24	SPLICE ONLY	NATURAL W/YELLOW STRIPE	—	—	4.32 [.17]	5.08 [.20]
		TWO DOTS	24 - 20	—	NATURAL W/WHITE STRIPE	4.83 [.19]	5.59 [.22]	5.59 [.22]	6.35 [.25]
	59300 RED AND WHITE	ONE DOT	26 - 24	TERMINALS ONLY	NATURAL W/YELLOW STRIPE	5.08 [.20]	5.84 [.23]	—	—
		TWO DOTS	24 - 20	—	NATURAL W/WHITE STRIPE	4.83 [.19]	5.59 [.22]	5.59 [.22]	6.35 [.25]
		ONE DOT	22 - 16	—	NATURAL W/RED STRIPE	5.08 [.20]	5.84 [.23]	6.35 [.25]	7.11 [.28]
	59170 59250 RED AND BLUE	ONE DOT	26 - 24	TERMINALS ONLY	NATURAL W/YELLOW STRIPE	5.08 [.20]	5.84 [.23]	—	—
			22 - 16	—	NATURAL W/RED STRIPE	5.08 [.20]	5.84 [.23]	6.35 [.25]	7.11 [.28]
		TWO DOTS	16 - 14	—	NATURAL W/BLUE STRIPE				
PIDG INSULATION RESTRICTING NYLON TERMINALS	59275 YELLOW AND WHITE	ONE DOT	26	0.66-1.40 [.026 - .055]	YELLOW W/BLACK STRIPE	4.83 [.19]	5.59 [.22]	—	—
			24	0.79-1.40 [.031 - .055]	YELLOW W/BLUE STRIPE				
			22	0.97-2.79 [.038 - .110]	RED W/GREEN STRIPE				
	59300 RED AND WHITE	ONE DOT	20	1.17-2.79 [.046 - .110]	RED W/RED STRIPE	6.35 [.25]	7.11 [.28]	—	—
			18	1.42-2.79 [.056 - .110]	RED W/WHITE STRIPE				
			22	0.97-2.79 [.038 - .110]	RED W/GREEN STRIPE				
	59170 RED AND BLUE	ONE DOT	20	1.17-2.79 [.046 - .110]	RED W/RED STRIPE				
			18	1.42-2.79 [.056 - .110]	RED W/WHITE STRIPE				
			16	1.60-3.30 [.063 - .130]	BLUE W/BLUE STRIPE				
		TWO DOTS	14	1.98-3.30 [.078 - .130]	BLUE W/GREEN STRIPE				

Figure 2 (Cont'd)

PRODUCT	TOOL NO. AND HANDLE COLOR CODE	DOT CODE	WIRE RANGE OR SIZE	WIRE INSULATION DIAMETER RANGE	INSULATION COLOR CODE	WIRE STRIP LENGTH				
						Terminals		Splices		
						Min.	Max.	Min.	Max.	
PIDG STRATO-THERM TERMINALS	69692-1 BLACK AND GREEN	ONE DOT	26 - 24	—	BLACK	4.06 [.16]	4.83 [.19]	—	—	
		TWO DOTS	22 - 20	—	GREEN					
	69693-1 ORANGE AND WHITE	ONE DOT	18 - 16	—	ORANGE	5.08 [.20]	5.84 [.23]	—	—	
		TWO DOTS	14	—	WHITE					
PIDG INSULATION RESTRICTING TEFLON STRATO-THERM TERMINALS	69692-1 BLACK AND GREEN	ONE DOT	26	0.66-1.40 [.026 - .055]	BLACK	4.83 [.19]	5.59 [.22]	—	—	
			24	0.79-1.40 [.031 - .055]	BLUE					
		TWO DOTS	22	0.97-2.79 [.038 - .110]	GREEN	6.35 [.25]	7.11 [.28]	—	—	
			20	1.17-2.79 [.046 - .110]	RED					
	69693-1 ORANGE AND WHITE	ONE DOT	18	1.42-2.79 [.056 - .110]	WHITE	6.35 [.25]	7.11 [.28]	—	—	
			16	1.60-3.30 [.063 - .130]	BLUE					
		TWO DOTS	14	1.98-3.30 [.078 - .130]	GREEN					

PRODUCT	TOOL NO. AND HANDLE COLOR CODE	DOT CODE	WIRE RANGE	SEAL LINER COLOR CODE	INSULATION COLOR CODE	WIRE STRIP LENGTH	
						Min.	Max.
SPARE WIRE CAP NO. 328307	59250 AND 59170 RED AND BLUE	ONE DOT	22 - 18	—	RED	7.87 [.31]	8.64 [.34]
SPARE WIRE CAP NO. 328308		TWO DOTS	16 - 14	—	BLUE		

Figure 2 (End)

NOTE


Refer to tool label for color code information. Note that Figure 2 indicates the number of dots that appear embossed on a crimped terminal, splice or cap. Observe the dot code on finished crimp to insure that correct product and tool combination was used.

NOTE


Dot code will disappear after heat sealing environment sealed splices.

4. WIRE STRIPPING AND CRIMPING PROCEDURES

NOTE


Refer to Section 5 for insulation crimp adjustment.



Do not re-terminate the splices or terminals.

4.1. PIDG and PLASTI-GRIP Terminals and Splices

- Strip wire to dimensions listed in Figure 2.

NOTE


Do not use wires with nicked or missing conductor strands

- Open crimping dies by closing handles until ratchet releases. See Figure 1. Note, that once ratchet is engaged, handles cannot be opened until they are first fully closed.

Crimp the color coded terminals and splices in the matching color coded portion of the tool. Refer to Section 3.

- Place terminal in crimping dies so that terminal tongue slides under locator. See Figure 3.

- Raise locator and place splice under locator as shown in Figure 4. Splice window indent faces top of tool.

NOTE


To properly position pre-insulated sealed splice, apply and maintain pressure against end of splice until Step 5 is completed. See Figure 4.

- Press quick take-up trigger and close handles until terminal or splice is held firmly in place. Do not deform terminal or splice wire barrel.

- Insert stripped wire into terminal until conductor butts against locator. See Figure 3. Insert stripped wire into splice until conductor butts against splice wire stop. See Figure 4.

NOTE


Do not allow wire insulation to enter wire barrel.

- Hold wire in position and complete crimp by closing handles until the ratchet releases.

- Refer to Section 6 and Figure 6 or Figure 7 for terminal or splice "Crimp Inspection" procedure.

PIDG and PLASTI-GRIP Terminals



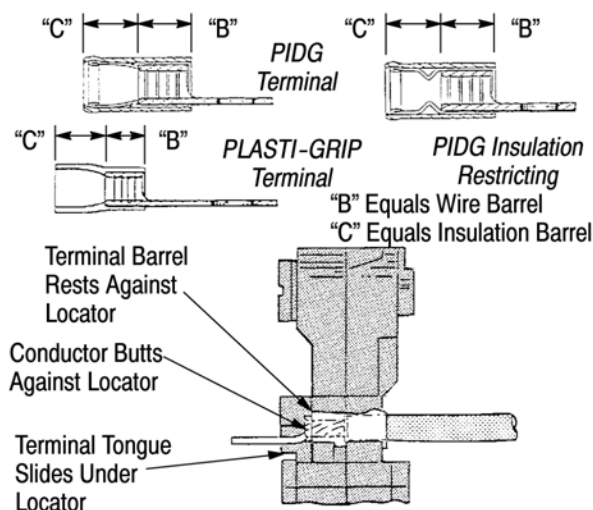


Figure 3

BUTT Splices

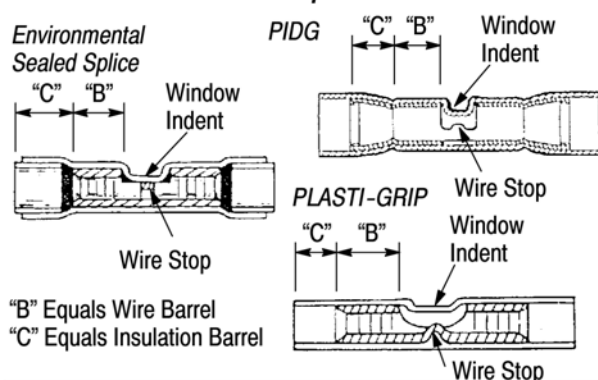

First Crimp

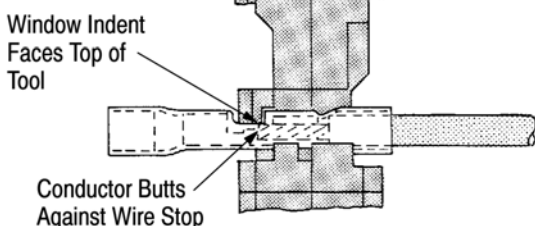

Second Crimp

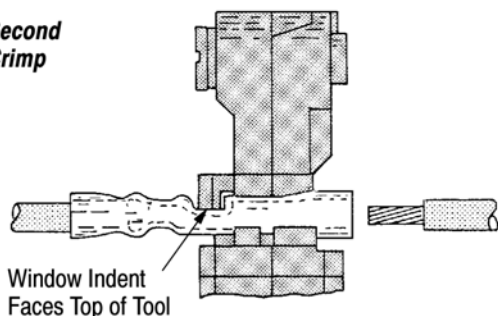


Figure 4

4.2. Spare Wire Caps

1. Strip wire to dimensions listed in Figure 2. Crimp the color coded portion of the tool. Refer to Section 3.

NOTE



Do not use wire with nicked or missing conductor strands.

2. Place tool insulation adjustment indicator in Position 4.
3. Close tool handles until crimping jaws partially close, but leave enough space for cap to be inserted between dies.
4. Raise locator so that end of cap rests against the recessed surface of the locator as shown in Figure 5.

Spare Wire Caps

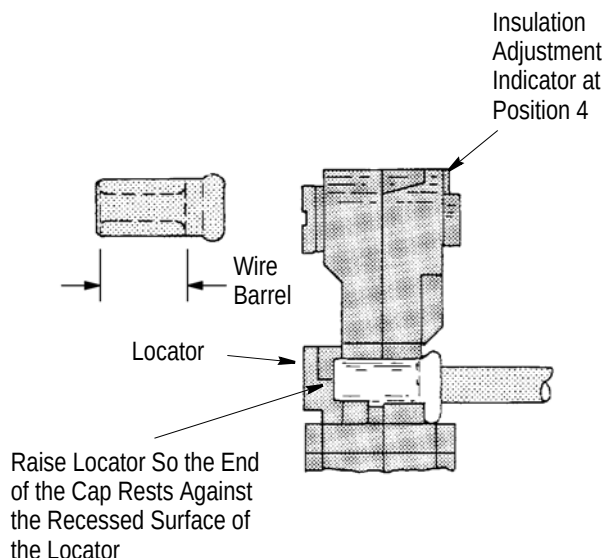


Figure 5


5. Squeeze quick take-up trigger and close handles until cap is held firmly in place. Do not deform cap wire barrel.
6. Insert stripped wire into cap until conductor bottoms in cap.
7. Hold wire in position and complete crimp by closing handles until the ratchet releases. Handles will open automatically and crimped cap may be removed.
8. Refer to Section 6 and Figure 7 wire cap crimp inspection procedure.

NOTE


Depending on the color and material of the crimped terminal, the dot codes may be difficult to see. Be sure to use good lighting and high magnification when looking for the dot codes.

Accept

A Dot Code (1 or 2 Dots) Must Appear on All Crimped Items

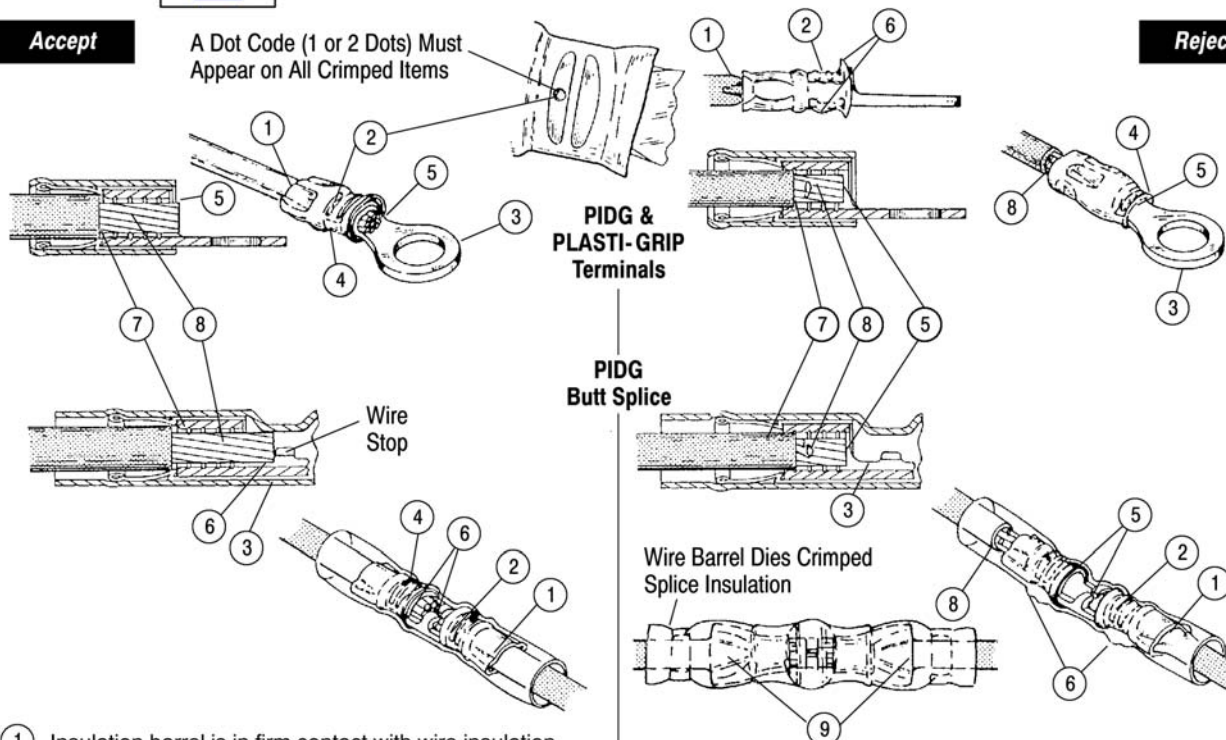

- ① Insulation barrel is in firm contact with wire insulation.
- ② Correct color code, dot code, and tool combination.
- ③ Wire size is within wire range stamped under terminal tongue or on center of splice.
- ④ Crimp centered on wire barrel.
- ⑤ End of conductor is flush with, or extends beyond end of terminal wire barrel.
- ⑥ End of conductor against wire stop of splice, or at least flush with, or extended slightly beyond wire barrel.
- ⑦ Wire insulation does not enter wire barrel.
- ⑧ No nicked or missing conductor strands.

- ① Wire insulation extruded. (Insulation crimp too tight on PIDG terminals and splices) See Section 5.
- ② Wrong dot code and color code combination. See Figure 2.
- ③ Wire size is not within wire range stamped on terminal tongue or splice.
- ④ Crimp not centered on wire barrel. (Terminal was not butted against locator. See Figure 3.)
- ⑤ End of conductor is not flush with or extending beyond end of wire barrel. (Check for correct strip length.)
- ⑥ Excessive flash or extruded insulation, (wrong tool, terminal, or splice combination, or damaged dies).
- ⑦ Wire insulation entered wire barrel.
- ⑧ Nicked or missing conductor strands.
- ⑨ Splice was reversed in dies (tool's locator was not seated in window indent of splice).

Figure 6

5. INSULATION CRIMP ADJUSTMENT

5.1. PIDG Terminals and Splices

NOTE


PIDG terminals and splices feature a wire "insulation grip".

Each tool has four insulation crimp positions. See Figure 1.

1. Loosen insulation adjustment locking screw (see top of tool) and turn indicator to Position 4.

2. Place terminal or splice in tool dies.

3. Insert UNSTRIPPED wire into ONLY the insulation barrel (see Figure 3 or Figure 4) of terminal or splice.

4. Perform a crimp (Section 4). Remove crimped terminal or splice and check insulation grip as follows: Bend the wire back and forth once. Terminal or splice should retain grip on wire insulation.

5. If wire pulls out, set insulation adjustment indicator to next tighter position - Position 3.

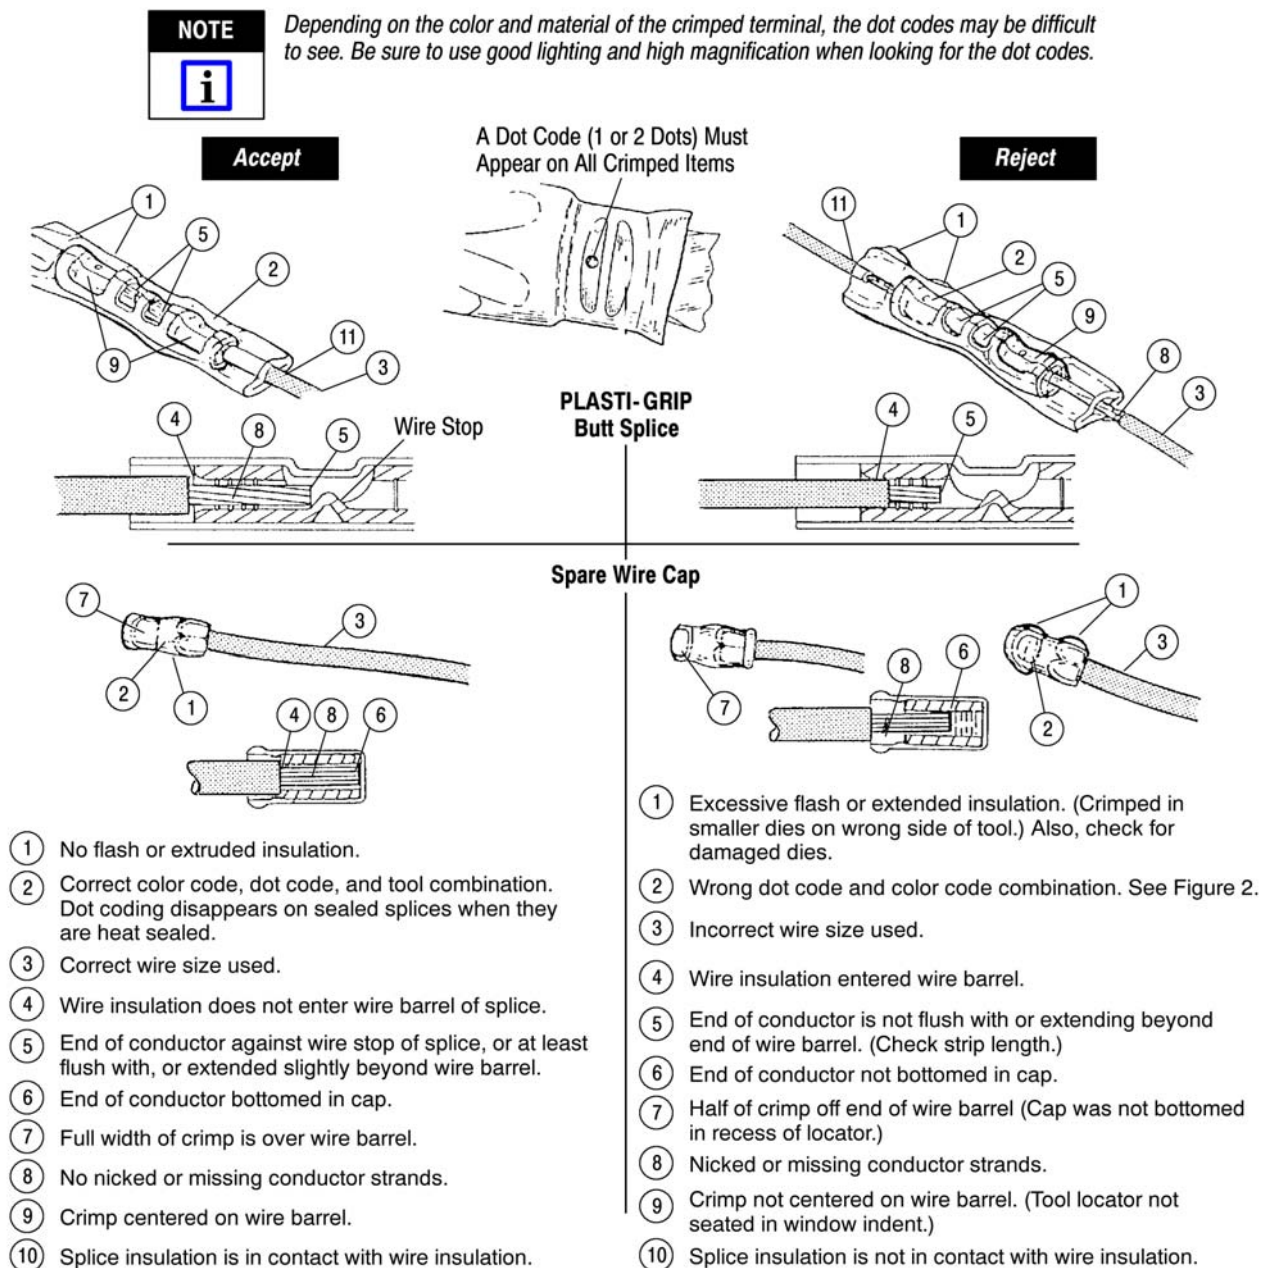


Figure 7

6. Perform a crimp and repeat adjustment as necessary until desired insulation grip is obtained. Do not use a tighter setting than required.

7. Tighten insulation adjustment locking screw (see top of tool).

5.2. PLASTI-GRIP Terminals and Splices

NOTE



PLASTI-GRIP terminals and splices feature a wire "insulation support" only.

1. Set insulation adjustment indicator in Position 4 for wire having a large insulation diameter.

2. Set insulation adjustment indicator in Position 3 for wire having a medium insulation diameter.

3. Set insulation adjustment indicator in Position 2 for wire having a small insulation diameter.

4. Set insulation adjustment indicator in Position 1 for wire having thin wall insulation. Terminal or splice insulation should ideally be in contact with wire insulation.

6. CRIMP INSPECTION

Inspect crimped terminals, splices and spare wire caps by checking the features described in Figure 6 or Figure 7.

Use only the crimped items that meet the conditions shown in the ACCEPT column.

REJECT terminals, splices, and spare wire caps can be avoided through careful use of instructions and by performing regular tool maintenance as instructed in this document.

NOTE  Locators in Crimping Tools 69692-1 and 69693-1 are locked in the down position. Refer to Instruction Sheet 408-7424 for crimp height inspection of these tools.

7. MAINTENANCE AND INSPECTION

TE recommends that a maintenance/inspection program be performed periodically to ensure dependable and uniform terminations. Tools should be inspected at least once a month. Frequency of inspection may be adjusted to suit your requirements through experience. Frequency of inspection is dependent upon:

1. The care, amount of use, and handling of the tool.
2. The type and size of the products crimped.
3. The degree of operator skill.
4. The presence of abnormal amounts of dust and dirt.
5. Your own established standards.

All tools are inspected before packaging. Since there is a possibility of tool damage in shipment, new tools should be inspected in accordance with Section 7 when received in your plant. Due to the precision design, it is important that no parts of these tools be interchanged except those replacement parts listed in Figure 13.

7.1. Cleaning

The tool should be immersed (handles partially closed) in degreasing compound to remove accumulated dirt, grease, and foreign matter.

NOTE  Make certain the degreasing compound does not attack paint or plastic materials.

Remove remaining degreasing compound with a lint free cloth. When degreasing compounds are not available, tool may be wiped clean with a lint free cloth. Relubricate tool, as instructed in Paragraph 7.3 before placing it back in service.

7.2. Visual Inspection

1. Visually inspect the tool for missing parts, then operate the tool and note the return action of the spring-loaded handles. If parts are missing or defective, refer to Figure 13 for customer replaceable parts.

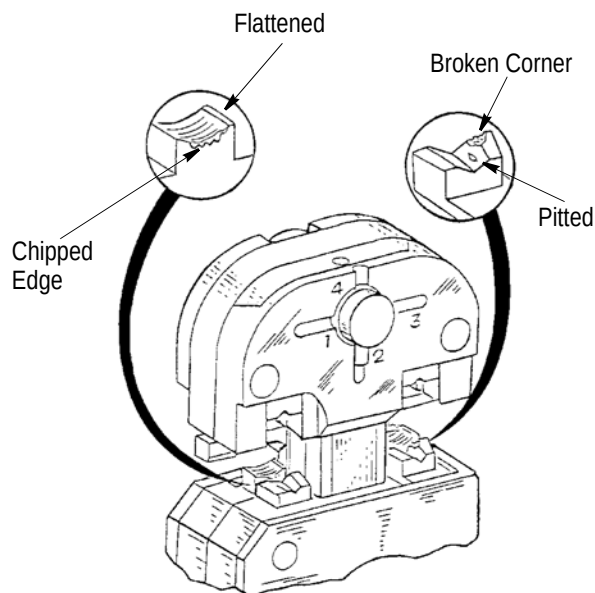


Figure 8

2. Visually inspect the die closure surfaces for flattened, broken, pitted, or chipped conditions. Although dies may gage within permissible limits, worn or damaged die closure surfaces are objectionable and can affect the quality of the crimp. Examples of possible damaged die closure surfaces are shown in Figure 8.

7.3. Lubrication

Lubricate all pins, pivot points, and bearing surfaces with SAE 20 motor oil as follows:

- Tools used in daily production-Lubricate daily
- Tools used daily (occasional)-Lubricate weekly
- Tools used weekly-Lubricate monthly

Wipe excess oil from tool, particularly from crimping area. Oil transferred from the crimping area onto certain terminations may affect the electrical characteristics of an application.

7.4. Gaging the Crimping Chamber

Each tool is inspected for proper die closures before packaging. An inspection should be performed periodically to check the tool die closures for excessive wear.

NOTE  The following plug gaging information for insulation crimping chambers is provided for customers specifically requiring this information. If plug gaging is not required, inspect the die closures using an alternate procedure, i.e., performing the "Insulation Crimp Adjustment" (see Section 5) and "Visual Inspection" (see Paragraph 7.2).

NOTE


Refer to the table in Figure 11 for alternate hard gage dimensions for tools 69692-1 and 69693-1.

A. Gaging the Crimping Chamber Using A Plug Gage

This inspection requires the use of plug gages conforming to the dimensions listed in Figure 9 and Figure 10. Tyco Electronics does not manufacture or market these gages. Refer to 408-7424 for information concerning plug gages

To gage the crimping area(s), refer to Figure 12 and proceed as follows:

1. Clean oil or dirt from the crimping chamber and plug gage.
2. Close handles of tool until wire barrel dies are bottomed. Do not apply additional pressure to tool handles.
3. With wire barrel dies bottomed, inspect the wire barrel crimping chamber using the proper plug gage. Lift the spring-loaded locator up and hold gage in straight alignment with the crimping

chamber. Carefully try to insert, without forcing, the GO element. See Figure 12, Detail A. The GO element must pass completely through the crimping area.


4. Try to insert the NO-GO element. The NO-GO element may enter partially, but must not pass completely through the crimping area.

5. Set insulation adjustment indicator in Position 1. Measure both insulation crimping chambers with the proper GO plug gages in the same manner as Steps 2 and 3. See Figure 12, Detail B.

6. Set insulation adjustment indicator in Position 4. Measure both insulation crimping chambers with the proper NO-GO plug gages in the same manner as Steps 2 and 4. See Figure 12, Detail B.

If the crimping areas conform to the gage inspection, the tool is considered dimensionally correct. If the crimping areas do not conform to the inspection, the tool must be repaired. Refer to Section 8, REPLACEMENT AND REPAIR.

Suggested Plug Gage Design - Wire Barrel Crimping Chamber

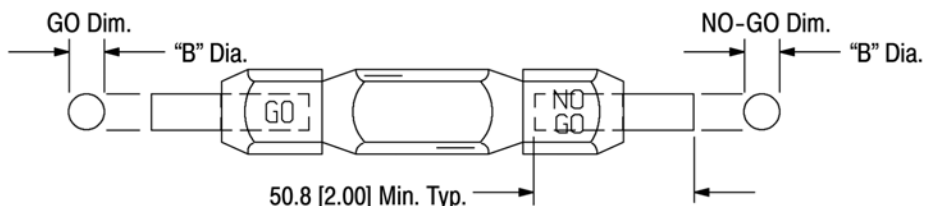

TOOL NUMBER	WIRE SIZE AWG	GAGE ELEMENT DIMENSION "B"	
		GO	NO-GO
59170 and 59250	22 - 16	2.769 - 2.776 [.1090 - .1093]	2.918 - 2.921 [.1149 - .1150]
	16 - 14	3.023 - 3.030 [.1190 - .1193]	3.172 - 3.175 [.1249 - .1250]
59275	26 - 22	1.600 - 1.608 [.0630 - .0633]	1.750 - 1.753 [.0689 - .0690]
	24 - 20	2.261 - 2.268 [.0890 - .0893]	2.410 - 2.413 [.0949 - .0950]
59300	24 - 20	2.261 - 2.268 [.0890 - .0893]	2.410 - 2.413 [.0949 - .0950]
	22 - 16	2.769 - 2.776 [.1090 - .1093]	2.918 - 2.921 [.1149 - .1150]

Use solder slug and crimp height comparator. (Reference 408-7424)

TOOL NUMBER	WIRE SIZE AWG	SOLDER SLUG CRIMP HEIGHT	SOLDER SLUG DIAMETER REFERENCE
69692-1	26 - 24	2.34 ± 0.05 [.092 ± .002]	1/8 Diameter
	22 - 20	2.69 ± 0.05 [.106 ± .002]	1/8 Diameter
69693-1	18 - 16	3.35 ± 0.05 [.132 ± .002]	#18 - 1/8 Dia. #16 - 3/16 Dia.
	14	3.86 ± 0.05 [.152 ± .002]	3/16 Diameter

Figure 9

B. Gaging the Crimping Chamber Using A Solder Slug and Crimp Height Comparator

This inspection requires the use of crimp height comparators, solder slugs, and the dimensions listed in Figure 10. Tyco Electronics does not manufacture or market crimp-height comparators. Refer to 408-7424 for information concerning comparators.

To gage the crimping chamber using the solder slug, proceed as follows:

1. Clean oil or dirt from the crimping chamber.
2. Set insulation adjustment to the number 1 position.
3. Insert proper solder slug into one crimp chamber (see Figure 9 and Figure 10) and cycle tool.
4. Measure the compressed solder slug for the wire-barrel crimping chamber and check for compliance to dimensions in Figure 9.
5. Measure the compressed area for the insulation-crimping chamber and check for compliance to the GO dimensions in Figure 10.
6. Set the insulation adjustment to the number 4 position and insert the appropriate solder slug into the insulation chamber.
7. Cycle the tool.
8. Measure the compressed area (of the solder) for the insulation-crimping chamber and check for compliance to the NO-GO dimensions in Figure 10.
9. Repeat the steps above for the second crimp chamber.

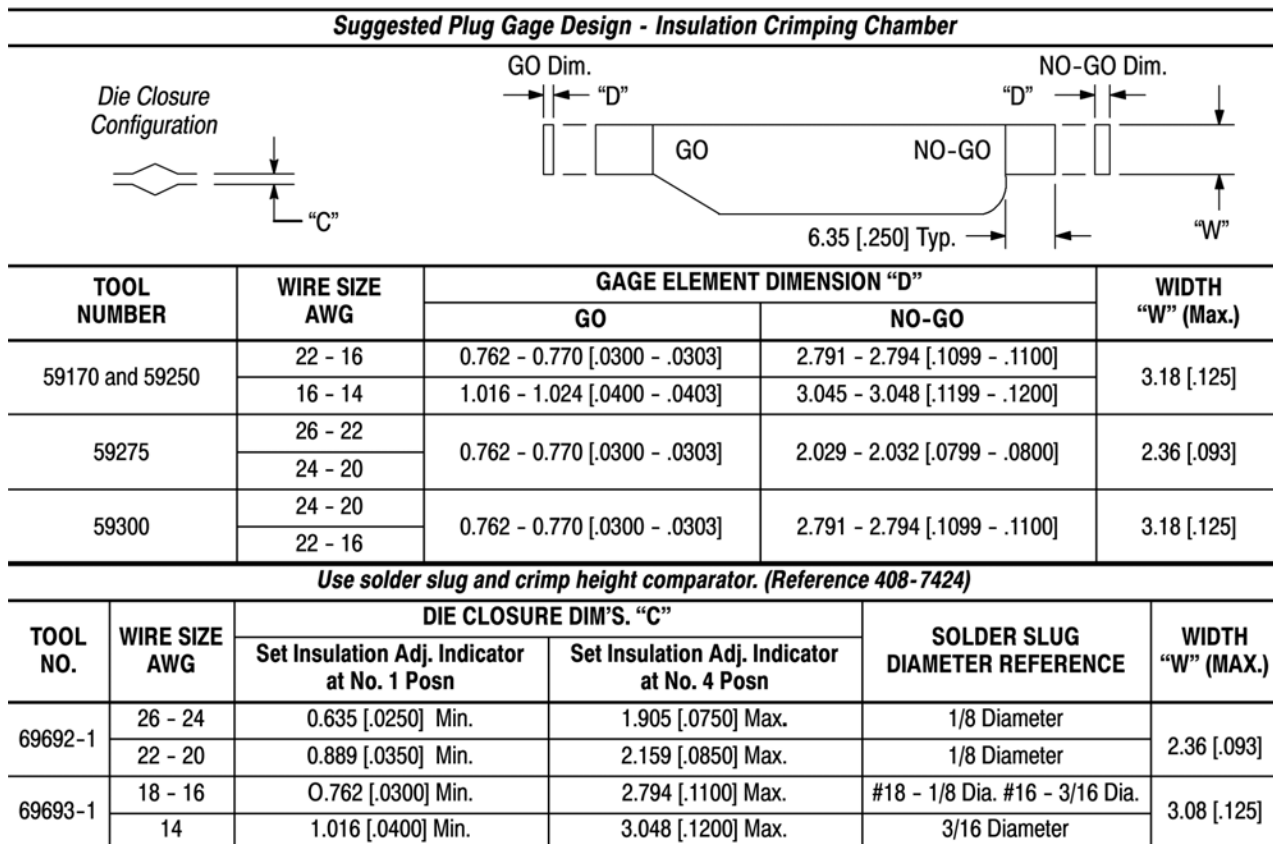


Figure 10

Suggested Plug Gage Design for Tools 69692-1 and 69693-1 - Insulation Crimping Chamber

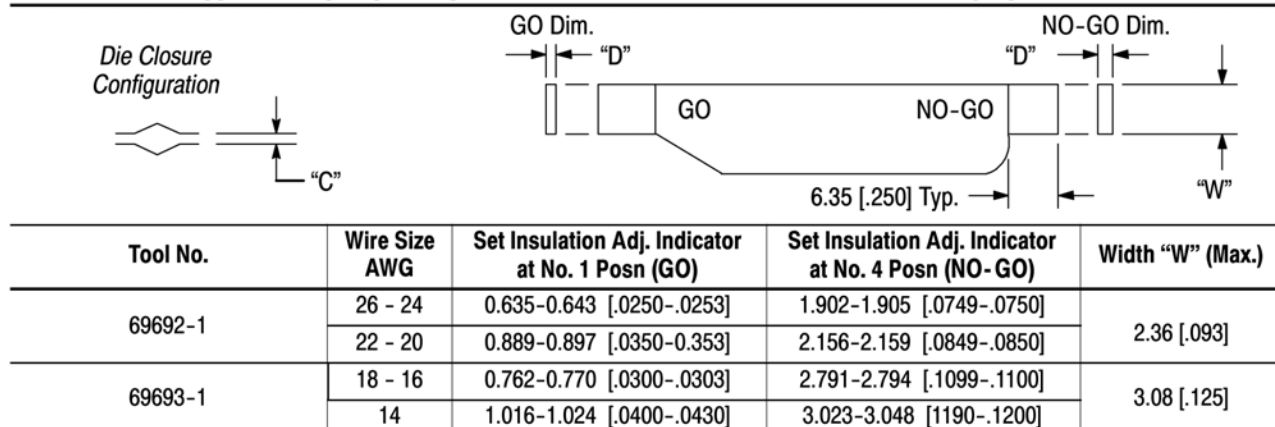


Figure 11

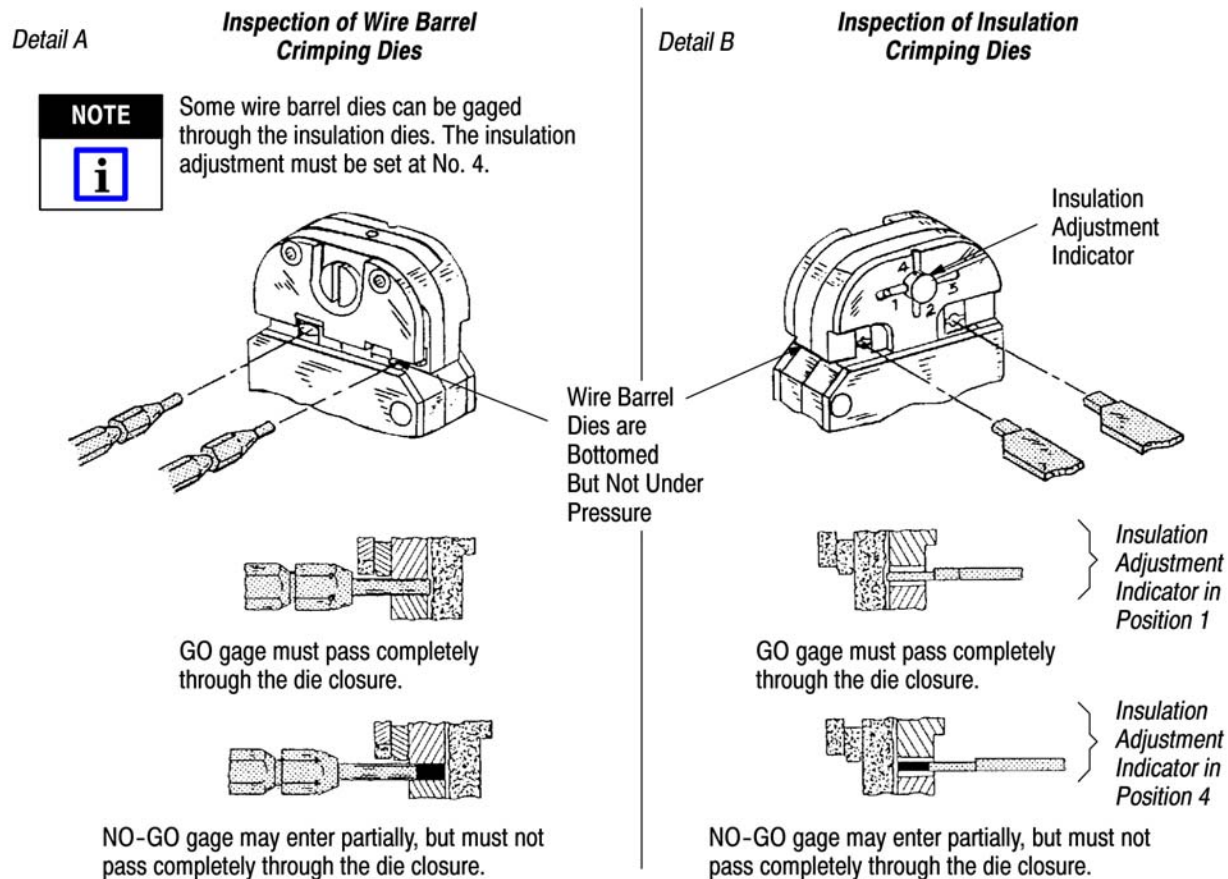


Figure 12

7.5. Ratchet Control Inspection

Obtain a .025-mm [.001-in.] shim that is suitable for checking the clearance between the bottoming surfaces of the crimping dies. To inspect the CERTI-CRIMP hand crimping tool ratchet control:

1. Perform a crimp using the largest wire size for your tool.
2. While holding the wire in place, squeeze the tool handles together until the ratchet releases. Hold the tool in this position, maintaining just enough pressure to keep the dies closed.

3. Check the clearance between the bottoming surfaces of the crimping dies. If the clearance is .025 mm [.001 in.] or less, the ratchet is satisfactory. If clearance exceeds .025 mm [.001 in.], the ratchet is out of adjustment, and must be repaired. Refer to Section 8, REPLACEMENT AND REPAIR. If the tool conforms to these inspection procedures, lubricate it with a THIN coat of any good SAE# 20 motor oil and return it to service.

8. REPLACEMENT AND REPAIR


Replacement parts are listed in Figure 13. Parts other than those listed in Figure 13 should be replaced by Tyco Electronics to ensure quality and reliability of the tool. Order replacement parts through your TE

Representative, or call 1-800-526-5142, or send a facsimile of your purchase order to 1-717-986-7605, or write to:

CUSTOMER SERVICE (038-035)
TYCO ELECTRONICS CORPORATION
PO BOX 3608
HARRISBURG PA 17105-3608

9. REVISION SUMMARY

Since the previous release of this sheet, the new company logo was applied.

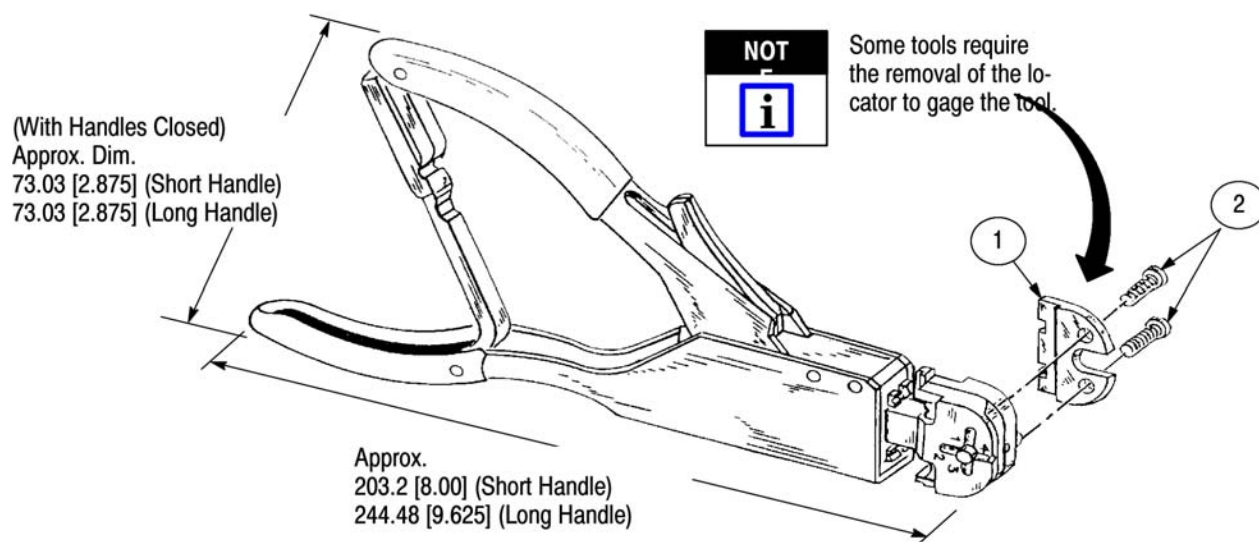

TOOL NUMBERS AND REPLACEMENT PART NUMBER

ITEM	DESCRIPTION	591 SHORT HANDLE 59250 LONG HANDLE	59275 SHORT HANDLE 59300 LONG HANDLE	69692-1 LONG HANDLE	69693-1 LONG HANDLE	QTY PER ASSY
1	Support, Locator	---	---	59755-1	59755-2	1
2	Screw	---	---	1-21002-3	1-21002-3	2

Figure 13

Компания «Океан Электроники» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Поставка оригинальных импортных электронных компонентов напрямую с производств Америки, Европы и Азии, а так же с крупнейших складов мира;
- Широкая линейка поставок активных и пассивных импортных электронных компонентов (более 30 млн. наименований);
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Помощь Конструкторского Отдела и консультации квалифицированных инженеров;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Поставка электронных компонентов под контролем ВП;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- При необходимости вся продукция военного и аэрокосмического назначения проходит испытания и сертификацию в лаборатории (по согласованию с заказчиком);
- Поставка специализированных компонентов военного и аэрокосмического уровня качества (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Actel, Aeroflex, Peregrine, VPT, Syfer, Eurofarad, Texas Instruments, MS Kennedy, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Компания «Океан Электроники» является официальным дистрибьютором и эксклюзивным представителем в России одного из крупнейших производителей разъемов военного и аэрокосмического назначения «JONHON», а так же официальным дистрибьютором и эксклюзивным представителем в России производителя высокотехнологичных и надежных решений для передачи СВЧ сигналов «FORSTAR».



JONHON

«JONHON» (основан в 1970 г.)

Разъемы специального, военного и аэрокосмического назначения:

(Применяются в военной, авиационной, аэрокосмической, морской, железнодорожной, горно- и нефтедобывающей отраслях промышленности)

«FORSTAR» (основан в 1998 г.)

ВЧ соединители, коаксиальные кабели,
кабельные сборки и микроволновые компоненты:

(Применяются в телекоммуникациях гражданского и специального назначения, в средствах связи, РЛС, а так же военной, авиационной и аэрокосмической отраслях промышленности).



Телефон: 8 (812) 309-75-97 (многоканальный)

Факс: 8 (812) 320-03-32

Электронная почта: ocean@oceanchips.ru

Web: <http://oceanchips.ru/>

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, д. 2, корп. 4, лит. А