


**Smart Sensors (Laser Type)** 

# ZX Series (ZX-L-N)

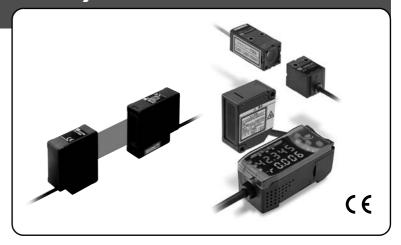

# **Ordering Information**

# **■** Sensors

# **Sensor Heads (Reflective)**

Optical system	Beam shape	Sensing distance	Resolution*1	Model
Diffuse reflective	Spot beam	40±10 mm	2 μm	ZX-LD40
		100±40 mm	16 μm	ZX-LD100
		300±200 mm	300 μm	ZX-LD300
	Line beam	40±10 mm	2 μm	ZX-LD40L
		100±40 mm	16 μm	ZX-LD100L
		300±200 mm	300 μm	ZX-LD300L
Regular reflective	Spot beam	30±2 mm	0.25 μm	ZX-LD30V
	Line beam			ZX-LD30VL

<sup>\*1.</sup> For an average count of 4,096.

# **Sensor Heads (Through-beam)**

Optical system	Measuring width	Sensing distance	Resolution*1	Model
Through-beam	1-mm dia.	0 to 2000 mm	4 μm	ZX-LT001
	5 mm	0 to 500 mm		ZX-LT005
	10 mm			ZX-LT010
	30 mm		12 μm	ZX-LT030

<sup>\*1.</sup> For an average count of 64.

# **Amplifier Units**

Appearance	Power supply	Output type	Model
and the second	DC	NPN	ZX-LDA11-N
		PNP	ZX-LDA41-N

Note: Compatible connection with the Sensor Head.

# <u>Accessories (Order Separately)</u> Calculating Unit

Appearance	Model
	ZX-CAL2

# **Side-view Attachments**

Appearance	Applicable Sensor Head	Model	Quantity
	ZX-LT1001/ LT005	ZX-XF12	1
1	ZX-LT010	ZX-XF22	

# **Logging Tool for Personal Computers**

Appearance	Nam	Model	
	Communica- tions Interface	RS-232C	ZX-SF11
	Unit	USB	ZX-SF21
	Smart Monitor (Logging Software + Function Setting Software)		ZX-SW11EV3 (See note 1.)

# **Setup Tool for Personal Computer**

Appearance	Name	Model	
		ZX-SFW11EV3 (See note 1.)	

Note 1. The ZX-SFW11EV3 or ZX-SW11EV3 is required to use the Smart Monitor with the ZX-LDA11-N/41-N. Earlier versions cannot be used.

2. The Smart Monitor Basic does not have a logging function. Other than the logging function, the Smart Monitor Basic supports the same functions as the Smart Monitor.

# Cables with Connectors on Both Ends (for Extension)\*1

Cable length	Model	Quantity
1 m	ZX-XC1A	1
4 m	ZX-XC4A	
8 m	ZX-XC8A	
9 m *2	ZX-XC9A	

<sup>\*1.</sup> Robot Cable models are also available. The model numbers are ZX-XC□R.

<sup>\*2.</sup> For use only with Reflective Sensors.

# **Specifications**

# ■ Sensor Heads (Reflective)

Item Model	ZX-LD40	ZX-LD100	ZX-LD300	ZX-LD30V	ZX-LD40L	ZX-LD100L	ZX-LD300L	Z3X-LD30VL
Optical system	Diffuse reflect	Diffuse reflective Regular reflective				Diffuse reflective		
Light source (wave	Visible-light se	emiconductor l	aser with a wa	velength of 65	0 nm and an o	utput of 1 mW	max.	
length)	EN class 2, F	DA class II						
Measurement point	40 mm	100 mm	300 mm	30 mm	40 mm	100 mm	300 mm	30 mm
Measurement range	±10 mm	±40 mm	±200 mm	±2 mm	±10 mm	±40 mm	±200 mm	±2 mm
Beam shape	Spot				Line	•		
Beam size*1	50-μm dia.	100-μm dia.	300-μm dia.	75-μm dia.	75 μm x 2 mm	150 μm x 2 mm	450 μm x 2 mm	100 μm x 1.8 mm
Resolution*2	2 μm	16 μm	300 μm	0.25 μm	2 μm	16 μm	300 μm	0.25 μm
Linearity*3	±0.2% FS (entire range)	±0.2% FS (80 to 120 mm)	±2% FS (200 to 400 mm)	±0.2% FS (entire range)	±0.2% FS (32 to 48 mm)	±0.2% FS (80 to 120 mm)	±2% FS (200 to 400 mm)	±0.2% FS (entire range)
Temperature characteristic*4	±0.03% FS/°C	(Except for Z	X-LD300 and 2	ZX-LD300L, wh	nich are ±0.1%	FS/°C.)		
Ambient illumination	Incandescent	lamp: 3,000 l>	max. (on light	receiving side	)			
Ambient temperature	Operating: 0 t	o 50°C, Storaç	ge: -15 to 60°C	(with no icing	or condensati	on)		
Ambient humidity	Operating and	d storage: 35%	to 85% (with i	no condensatio	on)			
Insulation resistance	20 M $\Omega$ min. a	t 500 VDC						
Dielectric strength	1,000 VAC, 50	0/60 Hz for 1 m	nin					
Vibration resistance (destruction)	10 to 150 Hz,	10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions						
Shock resistance (destruction)	300 m/s <sup>2</sup> 3 tin	nes each in six	directions (up	/down, left/righ	t, forward/back	(ward)		
Degree of protection	IEC60529, IP50 IEC60 IP40			IEC60529, IP40	IEC60529, IP	50		IEC60529, IP40
Connection method	Connector relay (standard cable length: 500 mm)							
Weight (packed state)	Approx. 150 g Approx. 2			Approx. 250 g	Approx. 150 g			Approx. 250 g
Materials	Case: PBT (polybutylene terephthalate), Cover: Aluminum, Lens: Glass Cover: Aluminum, Lens: Glass					olybutylene te num, Lens: Gla		Case and cov- er: Aluminum, Lens: Glass
Accessories	Instruction she	nstruction sheet, Laser warning label (English)						

<sup>\*1.</sup> Beam size: The beam size is defined by 1/e² (13.5%) of the strength of the beam at the beam center (measured value). Incorrect detection may occur if there is light leakage outside the defined spot and the material around the sensing object is more reflective than the sensing object.

Note: Highly reflective objects can result in incorrect detection by causing out-of-range measurements.

<sup>\*2.</sup> Resolution: The resolution is the deviation (±3σ) in the linear output when connected to the ZX-LDA Amplifier Unit. (The resolution is measured with the standard reference object (white ceramic), at the measurement point with the ZX-LDA set for an average count of 4,096 per period.) The resolution is given at the repeat accuracy for a stationary workpiece, and is not an indication of the distance accuracy. The resolution may be adversely affected under strong electromagnetic fields.
\*3. Linearity: The linearity is given as the error in an ideal straight line displacement output when measuring the standard reference object. The

linearity and measurement values vary with the object being measured.

Temperature characteristic: The temperature characteristic is measured at the measurement point with the Sensor and reference object (OMRON's standard reference object) secured with an aluminum jig.

# ■ Sensor Heads (Through-beam)

Item	Model	ZX-LT001		ZX-LT005	ZX-LT010	ZX-LT030	
Optical sys	tem	Through-beam					
Light source		Visible-light semi	Visible-light semiconductor laser with a wavelength of 650 nm				
(wave leng	th)	EN class 1, FDA	class II				
Maximu	m output	0.2 mW max.		0.35 mW max.		0.2 mW max.	
Measureme	ent width	1-mm dia.	1- to 2.5-mm dia.	5 mm	10 mm	30 mm	
Measureme distance	ent	0 to 500 mm	500 to 2,000 mm	0 to 500 mm			
Minimum s object	ensing	8-μm dia. (opaque)	8- to 50-μm dia. (opaque)	0.05-mm dia. (opaque)	0.1-mm dia. (opaque)	0.3-mm dia. (opaque)	
Resolution	*1	4 μm *2		4 μm *3		12 μm *4	
	Temperature ±0.2% FS/°C characteristic					±0.3% FS/°C	
Ambient ill	umination	Incandescent lam	p: 10,000 l× max. (	(on light-receiving side)			
Ambient te	mperature	Operating: 0 to 50	0°C, Storage: -25 to	o 70°C (with no icing or condensation)			
Ambient h	umidity	Operating: 35% to	o 85% (with no con	densation)			
Degree of p	protection	IEC60529, IP40					
Connection	n method	Connector relay (	standard cable lenç	gth: 500 mm)			
Weight (pa	cked state)	Approx. 220 g				Approx. 450 g	
Cable leng	th	Extendable up to	10 m with special e	extension cable.			
Materials	Case	Polyetherimide				Zinc die-cast	
Cover		Polycarbonate					
Front filter Glass							
Tightening torque 0.3 N m max.							
Accessorie	es	Instruction sheet,	Instruction sheet, Sensor Head-Amplifier Connection Cable				
		Optical axis adjustment seal Mounting Bra				Mounting Bracket	

<sup>\*1.</sup> This value is obtained by converting the deviation (±3 $\sigma$ ) in the linear output that results when the sensor head is connected to the amplifier unit, into the measurement width.

<sup>\*2.</sup> For an average count of 64. The value is 5 μm for an average count of 32. This is the value that results when a minimum sensing object blocks the light near the center of the 1-mm measurement width.

<sup>\*3.</sup> For an average count of 64. The value is 5  $\mu m$  for an average count of 32.

 $<sup>^{\</sup>star}4.$  For an average count of 64. The value is 15  $\mu m$  for an average count of 32.

# ■ Amplifier Units

Item Model	ZX-LDA11-N	ZX-LDA41-N			
Measurement period	150 μs				
Possible average count settings*1	1, 2, 4, 8, 16, 32, 64, 128, 256, 512, 1,024, 2,048, or 4,096				
Temperature characteristic	When connected to a Reflective Sensor Head: 0.01% FS/°C, When connected to a Through-beam Sel Head: 0.1% FS/°C				
Linear output*2	4 to 20 mA/FS, Max. load resistance: 300 $\Omega, \pm$ 4 V ( $\pm$	: 5 V, 1 to 5 V *3), Output impedance: 100 $\Omega$			
Judgement outputs (3 outputs: HIGH/PASS/LOW)*1	NPN open-collector outputs, 30 VDC, 50 mA max. Residual voltage: 1.2 V max.	PNP open-collector outputs, 30 VDC, 50 mA max. Residual voltage: 2 V max.			
Laser OFF input, zero reset input, timing input, reset input	ON: Short-circuited with 0-V terminal or 1.5 V or less OFF: Open (leakage current: 0.1 mA max.)	ON: Supply voltage short-circuited or supply voltage within 1.5 V OFF: Open (leakage current: 0.1 mA max.)			
Functions	Measurement value display, present value/set value/light level/resolution display, scaling, display reve display OFF mode, ECO mode, number of display digit changes, sample hold, peak hold, bottom hol peak-to-peak hold, self-peak hold, self-bottom hold, average hold, delay hold, intensity mode, zero re initial reset, ON-delay timer, OFF-delay timer, one-shot timer, deviation, previous value comparison, sensitivity adjustment, keep/clamp switch, direct threshold value setting, position teaching, 2-point teaching, automatic teaching, hysteresis width setting, timing inputs, reset input, monitor focus, linear output compensation, (A-B) calculations*4, (A+B) calculations*4, mutual interference*4, laser deterioration detection, zero reset memory, zero reset display, key lock				
Indications	Operation indicators: High (orange), pass (green), lo subdisplay (yellow), laser ON (green), zero reset (gre	w (yellow), 7-segment main display (red), 7-segment een), enable (green)			
Power supply voltage	12 to 24 VDC ±10%, Ripple (p-p): 10% max.				
Current consumption	140 mA max. with power supply voltage of 24 VDC (	(with Sensor connected)			
Ambient temperature	Operating: 0 to 50°C, Storage: -15 to 60°C (with no	icing or condensation)			
Ambient humidity	Operating and storage: 35% to 85% (with no conder	nsation)			
Insulation resistance	20 M $\Omega$ min. at 500 VDC				
Dielectric strength	1,000 VAC, 50/60 Hz for 1 min				
Vibration resistance (destruction)	10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions				
Shock resistance (destruction)	300 m/s <sup>2</sup> 3 times each in six directions (up/down, left/right, forward/backward)				
Connection method	Prewired (standard cable length: 2 m)				
Weight (packed state)	Approx. 350 g				
Materials	Case: PBT (polybutylene terephthalate), Cover: Poly	carbonate			
Accessories	Instruction sheet				

<sup>\*1.</sup> The response speed of the linear output is calculated as the measurement period × (average count setting + 1) (with fixed sensitivity). The response speed of the judgement outputs is calculated as the measurement period × (average count setting + 1) (with fixed sensitivity).

<sup>\*2.</sup> The output can be switched between a current output and voltage output using a switch on the bottom of the Amplifier Unit.

<sup>\*3.</sup> Setting is possible via the monitor focus function.

<sup>\*4.</sup> A Calculating Unit (ZX-CAL2) is required.

# ■ Calculating Unit

Item	ZX-CAL2	
Applicable Amplifier Units	ZX-LDA11-N/41-N/ZX-EDA11/41/ZX-TDA11/41	
Current consumption	12 mA max. (supplied from the Smart Sensor Amplifier Unit)	
Ambient temperature	Operating: 0 to 50°C, Storage: -15 to 60°C (with no icing or condensation)	
Ambient humidity	Operating and storage: 35% to 85% (with no condensation)	
Connection method	Connector	
Dielectric strength	1,000 VAC, 50/60 Hz for 1 min	
Insulation resistance	100 MΩ (at 500 VDC)	
Vibration resistance (destructive)	10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions	
Shock resistance (destructive) 300 m/s² 3 times each in six directions (up/down, left/right, forward/backward)		
Materials	Display: Acrylic, Case: ABS resin	
Weight (packed state)	Approx. 50 g	

# **■ ZX-series Communications Interface Unit**

lt	em	ZX-SF11		
Current consumption	n	60 mA max. (supplied by the Amplifier Unit)		
Applicable Amplifie	r Units	ZX Series		
Applicable Amplifier Unit versions		ZX-LDA□1-N Ver. 1.000 or higher ZX-EDA□1 Ver. 1.100 or higher ZX-TDA□1 Ver. 1.000 or higher		
Max. No. of Amplifie	er Units	5		
Communications functions port		RS-232C port (9-pin D-Sub Connector)		
	Communications protocol	CompoWay/F*		
	Baud rate	38,400 bps		
	Data configuration	Data bits: 8, Parity: none, Start bits: 1, Stop bits: 1, Flow control: none		
Indicators		Power supply: green, Sensor communications: green, Sensor communications error: red, External terminal communications: green, External terminal communications error: red		
Protective circuits		Reverse polarity protection		
Ambient temperatur	е	Operating: 0 to 50°C, storage: –15 to 60°C (with no icing or condensation)		
Ambient humidity		Operating and storage: 35% to 85% (with no condensation)		
Insulation resistance		20 MΩ min. (at 500 VDC)		
Dielectric strength		1,000 VAC, 50/60 Hz for 1 min, Leakage current: 10 mA max.		
Materials		Case: PBT (polybutylene terephthalate), Cover: Polycarbonate		
Accessories		Instruction sheet, 2 clamps		

<sup>\*</sup> Contact your OMRON representative for CompoWay/F communications specifications.

# **Engineering Data (Typical)**


# **Angle Characteristic (Reflective Sensors)**

The angle characteristic plots the relation between the inclination of the measurement object and the error in the linear output at the measurement point.


Note: SUS304 = Stainless steel SUS304

# ● ZX-LD40

### Side-to-side Inclination

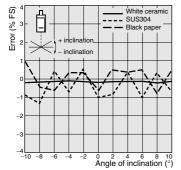


# Front-to-back Inclination

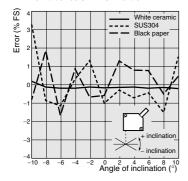


# ● ZX-LD40L

# Side-to-side Inclination

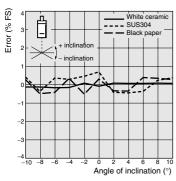


# Front-to-back Inclination

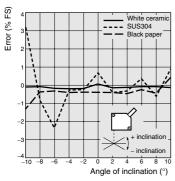


# ● ZX-LD100

# Side-to-side Inclination

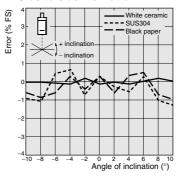


### Front-to-back Inclination

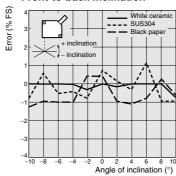


# ● ZX-LD100L

# Side-to-side Inclination

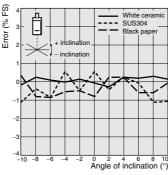


# Front-to-back Inclination

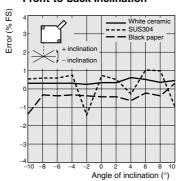


# ● ZX-LD300

### Side-to-side Inclination

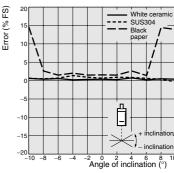


### Front-to-back Inclination

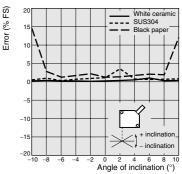


# ● ZX-LD300L

# Side-to-side Inclination

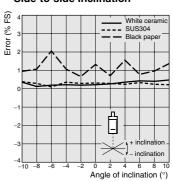


# Front-to-back Inclination

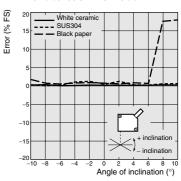


# ● ZX-LD30V

# Side-to-side Inclination

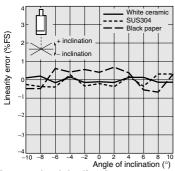


# Front-to-back Inclination

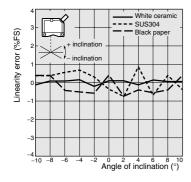


# ● ZX-LD30VL

# Side-to-side Inclination

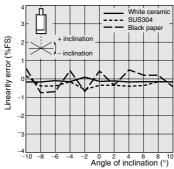


# Front-to-back Inclination

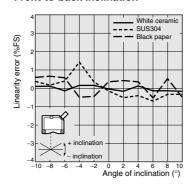


# **Linearity Characteristic for Different Materials (Reflective Sensors)**

# **● ZX-LD40**


### 0° Inclination

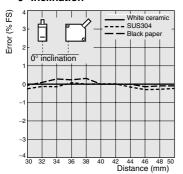

# −10° Inclination Front-to-back

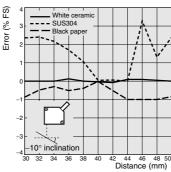


10° Inclination

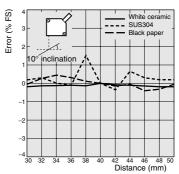


# ● ZX-LD100


# 0° Inclination

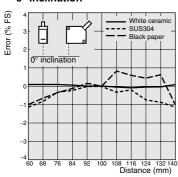

-10° Inclination Front-to-back

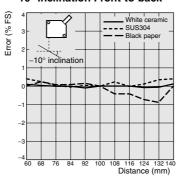


10° Inclination

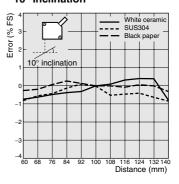


# ● ZX-LD300


# 0° Inclination

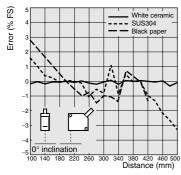

-10° Inclination Front-to-back

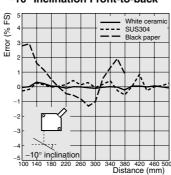


10° Inclination

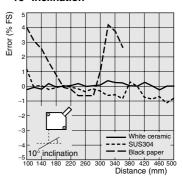


# ● ZX-LD40L


# 0° Inclination

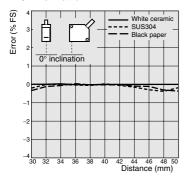

-10° Inclination Front-to-back

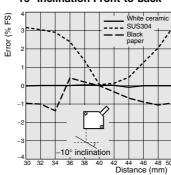


10° Inclination

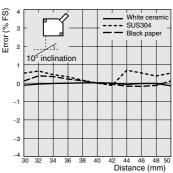


# ● ZX-LD100L


### 0° Inclination

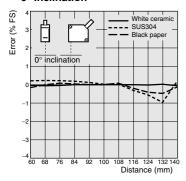

# -10° Inclination Front-to-back

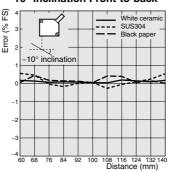


# 10° Inclination

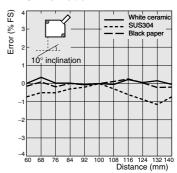


# ● ZX-LD300L


# 0° Inclination

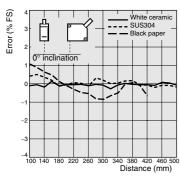

### -10° Inclination Front-to-back

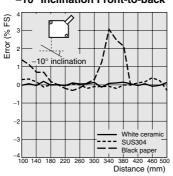


10° Inclination

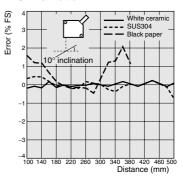


# ● ZX-LD30V


# 0° Inclination

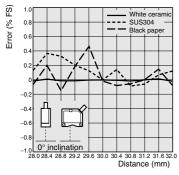

-10° Inclination Front-to-back

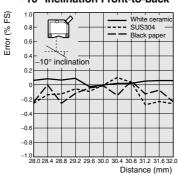


10° Inclination

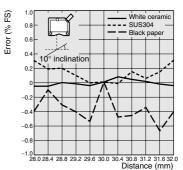


# ● ZX-LD30VL


# 0° Inclination

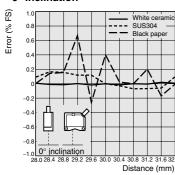

-10° Inclination Front-to-back

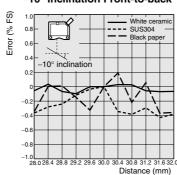


10° Inclination

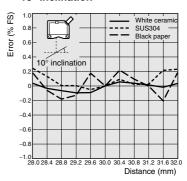

# Beam Size (Reflective Sensors)

# Spot Beams

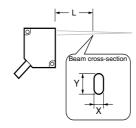

# ZX-LD40

L	30 mm	40 mm	50 mm
X	240 μm	40.0 μm	250 μm
Υ	350 μm	30.0 μm	370 μm


# ZX-LD100

L	60 mm 100 mm		140 mm	
X	390 μm	100 μm	430 μm	
Υ	620 μm	65.0 μm	650 μm	

# ZX-LD300

L	100 mm	100 mm 300 mm	
X	1,050 μm	180 μm	1,100 μm
Υ	450 μm	300 μm	850 μm

# **● Line Beams**



# ZX-LD40L

L	30 mm	30 mm 40 mm	
X	2,000 μm	2,000 μm	2,000 μm
Υ	240 μm	50.0 μm	250 μm


# ZX-LD100L

L	60 mm	100 mm	140 mm
Х	2,000 μm	2,000 μm	2,000 μm
Υ	410 μm	100 μm	430 μm

# ZX-LD300L

L	100 mm	300 mm	500 mm
X	2,000 μm	2,000 μm	2,500 μm
Υ	750 μm	300 μm	650 μm


# Spot Beams



# ZX-LD30V

L	28 mm	30 mm	32 mm
X	60.0 μm	30.0 μm	120 μm
Υ	50.0 μm	40.0 μm	90.0 μm

# Line Beams




# ZX-LD30VL


L	28 mm	28 mm 30 mm	
Х	1,800 μm	1,800 μm	1,800 μm
Υ	90.0 μm	60.0 μm	110 μm

# **Sensing Object Characteristics (Through-beam Sensors)**

# ● ZX-LT001

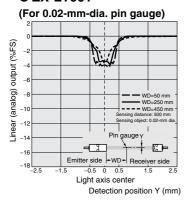


# ● ZX-LT001

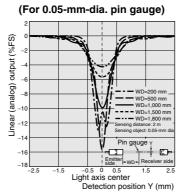


# ● ZX-LT005

(For 0.05-mm-dia. pin gauge)

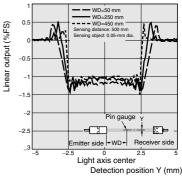


# ● ZX-LT010

# (For 0.1-mm-dia. pin gauge)

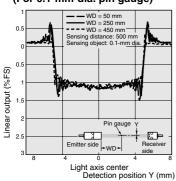


# **Linearity Characteristics**

# ● ZX-LT005

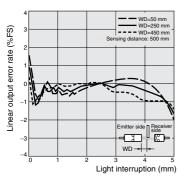

# ● ZX-LT010

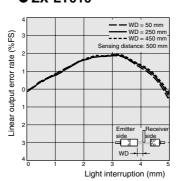



# **Linear Output vs. Sensing Distance**

The output can be switched between a current output and a voltage output using a switch on the Amplifier Unit.

# ZX-LD40/LD40L


# **Current Output**

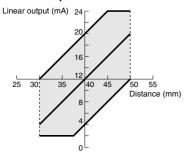

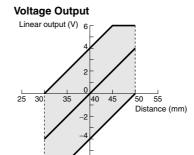


# ZX-LD100/LD100L

### **Current Output**

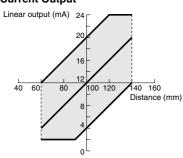




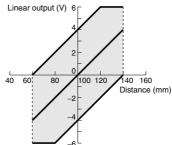


# ZX-LD300/LD300L

# **Current Output**

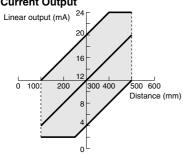




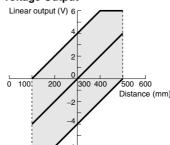


# ZX-LD30V/LD30VL

# **Current Output**

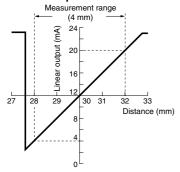

# **Voltage Output**

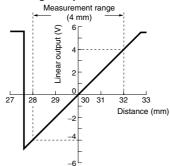


# I/O Circuit Diagrams


# NPN Amplifier Unit: ZX-LDA11-N

# Brown: 12 to 24 VDC White: HIGH output Green: PASS output Gray: LOW output Blue: GND (0V) Pink: Laser OFF input Purple: Timing input Orange: Zero reset input Red: Reset input A to 20 mA Shield: Linear GND Current output: 300 Ω max. Voltage output: 10 kΩ min.

# **PNP Amplifier Unit: ZX-LDA41-N**

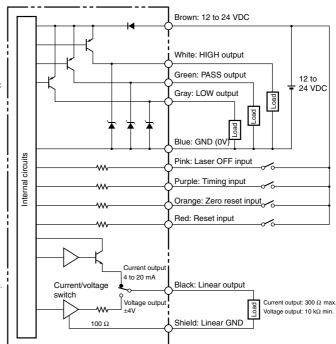


# **Connections: Amplifier Unit**

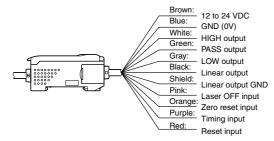


**Note 1.** Use a separate stabilized power supply for the Amplifier Unit, particularly when high resolution is required.

- 2. Wire the Unit correctly. Incorrect wiring may result in damage to the Unit. (Do not allow wiring, particularly the linear output, to come into contact with other lines.)
- 3. Use the 0-V line (blue) for the power supply and use the shield wire (linear output ground) together with the linear output (black line) for linear output. Each of these grounds must be used for the designed purpose. When not using the linear output, connect the linear ground (shield) to the 0-V ground.

# **Part Names**

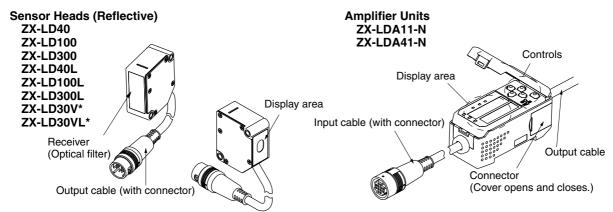

\*The dimensions for these models are slightly different. Refer to page 23 for details.

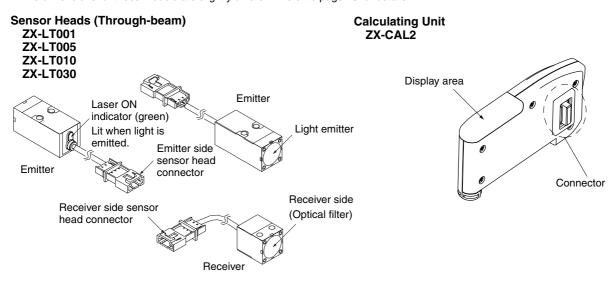

# **Precautions**

# ■ Design Precautions

# **Ratings and Performance**

- Conform to the specified ratings and performance. Refer to Specifications for details.
  - Do not impose voltage exceeding the rated voltage, otherwise the Sensor may be damaged.
  - When supplying power to the Sensor, make sure that the polarity of the power is correct, otherwise, the Sensor may be damaged. Do not connect to an AC power supply.
  - Do not short-circuit the load for the open collector output, otherwise the Sensor may be damaged.
- Do not disconnect the connector connecting the Sensor Head and the controller while power is being supplied, otherwise the Sensor may be damaged.
- Allow a warm-up period of approximately 10 minutes after turning ON the power supply.
- Objects of certain materials or shapes may not be detectable, or the detection accuracy may not be sufficiently high. These include materials that are transparent or have extremely low reflectivity, and objects that are smaller than the Sensor's spot diameter or have extreme curvature or inclination.

# **Power Supply and Wiring**

- Prior to turning ON the power supply after wiring is completed, check to make sure that the power supply is correct, that there are no mistaken connections, e.g., connections that would short-circuit the load, and that the load current is appropriate. Incorrect wiring may result in damage to the Sensor or Unit.
- The total length of the Sensor cable or Amplifier cable must be 10 m or less. Use an ZX-XC□A Extension Cable (order separately) if required to extend the cable from the Sensor. Use a shielded cable to extend the Amplifier cable. The shielded cable must be the same as that of the Amplifier cable.
- Do not lay a power supply cable for the ZX together with high-voltage lines or power lines to prevent interference, damage, and malfunction.
- When using a commercially available switching regulator, ground the FG (frame ground) terminal.
- If the power supply line is subject to surges, connect a surge absorber that meets the conditions of the usage environment.
- When using a Calculating Unit, connect the corresponding linear ground of the Amplifier Unit.

# **Compatibility**

All Sensor Heads and Amplifier Units are compatible. Different Sensor Heads may be purchased at a later date and used with existing Amplifier Units.

# **Mutual Interference**

 Two Sensor Heads can be used together, without danger of mutual interference, by connecting the ZX-CAL 2 Calculating Unit between two Amplifier Units.

# **Maintenance**

- Always turn OFF the power supply before adjusting or removing the Sensor Head.
- Cleaning
- Do not use thinners, benzine, acetone, or kerosene for cleaning. If dust or oil adheres to the filter on the front of the Sensor Head, use the following procedure to clean.
- Use a blower brush (used to clean camera lenses) to blow large dust particles from the surface. Do not blow the dust away with your mouth.
- Use a soft cloth (for lenses) with a small amount of alcohol to remove the remaining dust. Do not use a scrubbing action when cleaning because scratches on the filter could result in Sensor inaccuracy.

# **■** Other Precautions

# **Environment**

- Do not use the Sensor in strong electromagnetic fields or in an environment where the operation of the Sensor is subject to the reflection of intense light (such as other laser beams or electric arc-welding machines.)
- 2. Do not operate the Sensor in the following locations:
  - · Locations subject to strong vibration.
  - Locations subject to direct sunlight or near heating equipment.
  - · Locations subject to high humidity.
  - Locations where the Sensor would accumulate dust, dirt, metallic powder, etc.
  - · Locations subject to corrosive or flammable gases.
  - Locations subject to exposure to organic solvents, water, oil, etc.
  - Locations subject to strong electromagnetic or electrical fields.
  - Locations subject to rapid changes in temperature.
  - · Locations subject to freezing.

# **Laser Safety**

The ZX-LD-Series Sensor Heads are FDA Class II and EN Class 2 Laser Products. The ZX-LT-Series Sensor Heads are FDA Class II and EN Class 1 Laser Products. The ZX Series is meant to be built into final system equipment. Pay special attention to the following precautions for the safe use of the product:

Note: Europe: Class 1 and Class 2 of EN60825-1: 1994 = IEC825-1: 1993 U.S.A.: Class I and Class II of FDA (21 CFR1040.10)

- 1. Use this product as specified in this instruction manual. Otherwise, you may be exposed to hazardous laser radiation.
- 2. The ZX-series Smart Sensors radiate laser beams in the visible light range. Do not expose your eyes directly to the laser radiation. Ensure that the laser beam path is terminated during use. If a mirror or shiny surface is positioned in the laser beam path, ensure that the reflected beam path is also terminated. If the Unit must be used without terminating the laser beam path, position the laser beam path so that it is not at eye level
- 3. To avoid exposure to hazardous laser radiation, do not displace nor remove the protective housing during operation, maintenance, and any other servicing.
- 4. The user should return the product to OMRON for all repair and servicing.
- 5. As for other countries, observe the regulations and standards specified by each country.



# **Requirements from Regulations and Standards**

# EN60825-1 "Safety of Laser Products, Equipment Classification, Requirements and User's Guide"

# Summary of Manufacturer's Requirements

Requirements;	Classification					
Sub-clause	Class 1	Class 2	Class 3A	Class 3B*	Class 4	
Description of hazard class	Safe under reason- ably foreseeable con- ditions	Low power; eye pro- tection normally af- forded by aversion responses	Same as Class 2. Direct intrabeam viewing with optical aids may be hazardous	Direct intrabeam viewing may be hazardous	High power; diffused reflection may be hazardous	
Protective housing	Required for each lase	r product; limits access	necessary for perform	ance of functions of the	products	
Safety interlock in pro- tective housing	Designed to prevent re assigned	moval of the panel until	accessible emission va	lues are below the AEL (s	see note 2) for the class	
Remote control	Not required			Permits easy addition o ser installation	f external interlock in la-	
Key control	Not required			Laser inoperative when	key is removed	
Emission warning de- vice	Not required			Gives audible or visible switched on or if capaci is being charged	warning when laser is tor bank of pulsed laser	
Attenuator	Not required			Gives means beside ON/OFF switch to temporarily block beam		
Location controls	Not required		Controls so located the Classes 1 or 2 when a	at there is no danger of eadjustments are made.	exposure to AEL above	
Viewing optics	Emission from all view	ing systems must be b	elow Class 1 AEL's as a	applicable		
Scanning	Scan failure shall not of	ause product to excee	d its classification			
Class label	Required wording	Figures A and B and s	specified wording			
Aperture label	Not required			Specified wording requ	ired	
Service entry label	Required as appropria	te to the class of acces	sible radiation			
Override interlock label	Required under certain	n conditions as appropr	iate to the class of lase	r used		
User information	Operation manuals must contain instructions for safe use					
Purchasing and service information	Promotion brochures must reproduce classification labels; service manuals must contain safety information				ty information	
Medical products	Special calibration instructions required			Special calibration instrueasurement and target		
Fibre optic	Cable service connect above Class 1	ions require tool to disc	connect if disconnection	breaks protective housing	ng and permits access	

<sup>\*</sup>With respect to the requirements of remote interlock connector, key control, emission warning and attenuator, Class 3B laser products not exceeding five times the AEL of Class 2 in the wavelength range of 400 nm to 700 nm are to be treated as Class 3A laser products.

Note 1. This table is intended to provide a convenient summary of requirements. See text of this standard for complete requirements.

2. AEL: Accessible Emission Limit
The maximum accessible emission level permitted within a particular class.
For your reference, see ANSI Z136.1-1993, Section 2.

Symbol and border: black Background: yellow



Figure A Warning label - Hazard symbol

Legend and border: black Background: yellow



Figure B Explanatory label

# ● FDA (Compliance Guide for Laser Products, 1985, according to 21 CFR1040.10)

Requirements			Class (se	e note 1)		
	I	lla	II	Illa	IIIb	IV
Performance (all laser prod	ducts)	•	•	•		
Protective housing	R (see note 2)					
Safety interlock	R (see notes 3, 4)					
Location of controls	N/A	R	R		R	R
Viewing optics	R	R	R	R	R	R
Scanning safeguard	R	R	R	R	R	R
Performance (laser system	ns)					
Remote control connector	N/A	N/A	N/A	N/A	R	R
Key control	N/A	N/A	N/A	N/A	R	R
Emission indicator	N/A	N/A	R	R	R (see note 10)	R (see note 10)
Beam attenuator	N/A	N/A	R	R	R	R
Reset	N/A	N/A	N/A	N/A	N/A	R (see note 13)
Performance (specific purp	oose products)					
Medical	S	S	S	S (see note 8)	S (see note 8)	S (see note 8)
Surveying, leveling, alignment	S	S	S	S	NP	NP
Demonstration	S	S	S	S	S (see note 11)	S (see note 11)
Labeling (all laser products	s)					
Certification & identification	R	R	R	R	R	R
Protective housing	D (see note 5)					
Aperture	N/A	N/A	R	R	R	R
Class warning	N/A	R (see note 6)	R (see note 7)	R (see note 9)	R (see note 12)	R (see note 12)
Information (all laser produ	icts)					
User information	R	R	R	R	R	R
Product literature	N/A	R	R	R	R	R
Service information	R	R	R	R	R	R

# Abbreviations:

R: Required.

N/A: Not applicable.

S: Requirements: Same as for other products of that Class.

Also see footnotes.

NP: Not permitted.

D: Depends on level of interior radiation.

# Footnotes:

- 1. Based on highest level accessible during operation.
- 2. Required wherever & whenever human access to laser radiation above Class I limits is not needed for product to perform its function.
- 3. Required for protective housings opened during operation or maintenance, if human access thus gained is not always necessary when housing is open.
- 4. Interlock requirements vary according to Class of internal radiation.
- 5. Wording depends on level & wavelength of laser radiation within protective housing.
- 6. Warning statement label.
- 7. CAUTION logotype.
- 8. Requires means to measure level of laser radiation intended to irradiate the body.
- 9. CAUTION if 2.5 mW cm<sup>2</sup> or less, DANGER if greater than 2.5 mW cm<sup>2</sup>.
- 10. Delay required between indication & emission.
- 11. Variance required for Class IIb or iV demonstration laser products and light shows.
- 12. DANGER logotype.
- 13. Required after August 20, 1986.

# **Use Precautions**

# ● EN60825-1

Requirements;			Classification		
Sub-clause	Class 1	Class 2	Class 3A	Class 3B*	Class 4
Remote interlock	Not required			Connect to room or do	or circuits
Key control	Not required			Remove key when not	in use
Beam attenuator	Not required			When in use prevents	inadvertent exposure
Emission indicator device	Not required			Indicates laser is energ	gized
Warning signs	Not required			Follow precautions on	warning signs
Beam path	Not required	Terminate beam at en	d of useful length		
Specular reflection	No requirements			Prevent unintentional r	reflections
Eye protection	No requirements		Required if engineering and MPE exceeded	g and administrative pro	cedures not practicable
Protective clothing	No requirements			Sometimes required	Specific requirements
Training	No requirements		Required for all operat	or and maintenance per	sonnel

<sup>\*</sup>With respect to the requirements of remote interlock connector, key control, beam attenuator, and emission indicator, Class 3B laser products not exceeding five times the AEL of Class 2 in the wavelength range of 400 nm to 700 nm are to be treated as Class 3A laser products.

Note: This table is intended to provide a convenient summary of requirements. See text of this standard for complete precautions.

# ◆ ANSI Z136.1:1993 "American National Standard for the Safe Use of Lasers" Control Measures for the Four Laser Classes

Control measures		Classification						
Engineering Controls	1	2a	2	3a	3b	4		
Protective Housing (4.3.1)	Х	Х	Х	Х	Х	Х		
Without Protective Housing (4.3.1.1)	LSO (see	LSO (see note 2) shall establish Alternate Controls						
Interlocks on Protective Housing (4.3.2)	☆	☆	☆	☆	Х	Х		
Service Access Panel (4.3.3)	☆	☆	☆	☆	X	Х		
Key Control (4.3.4)					•	Х		
Viewing Portals (4.3.5.1)			MPE	MPE	MPE	MPE		
Collecting Optics (4.3.5.2)	MPE	MPE	MPE	MPE	MPE	MPE		
Totally Open Beam Path (4.3.6.1)					X NHZ	X NHZ		
Limited Open Beam Path (4.3.6.2)					X NHZ	X NHZ		
Enclosed Beam Path (4.3.6.3)	None is re	equired if 4.3.1	and 4.3.2 fulfil	led	<u> </u>	•		
Remote Interlock Connector (4.3.7)					•	Х		
Beam Stop or Attenuator (4.3.8)					•	Х		
Activation Warning Systems (4.3.9)					•	Х		
Emission Delay (4.3.9.1)						Х		
Indoor Laser Controlled Area (4.3.10)					X NHZ	X NHZ		
Class 3b Laser Controlled Area (4.3.10.1)					X			
Class 4 Laser Controlled Area (4.3.10.2)						Х		
Laser Outdoor Controls (4.3.11)					X NHZ	X NHZ		
Laser in Navigable Airspace (4.3.11.2)				•	•	•		
Temporary Laser Controlled Area (4.3.12)	☆ MPE	☆ MPE	☆ MPE	☆ MPE				
Remote Firing & Monitoring (4.3.13)						•		
Labels (4.3.14 and 4.7)	Х	Х	Х	Х	Х	Х		
Area Posting (4.3.15)				•	X NHZ	X NHZ		
Administrative & Procedural Controls	1	2a	2	3a	3b	4		
Standard Operating Procedures (4.4.1)					•	Х		
Output Emission Limitations (4.4.2)				LSO Determination				
Education and Training (4.4.3)			•	•	Х	Х		
Authorized Personnel (4.4.4)					Х	Х		
Alignment Procedures (4.4.5)			Х	Х	Х	Х		

Control measures	Classification					
Protective Equipment (4.4.6)					•	Х
Spectator (4.4.7)					•	Х
Service Personnel (4.4.8)	☆ MPE	☆ MPE	☆ MPE	☆ MPE	Х	Х
Demonstration with General Public (4.5.1)	MPE †		Х	Х	Х	Х
Laser Optical Fiber Systems (4.5.2)	MPE	MPE	MPE	MPE	Х	Х
Laser Robotic Installations (4.5.3)					X NHZ	X NHZ
Eye Protection (4.6.2)					• MPE	X MPE
Protective Windows (4.6.3)					X NHZ	X NHZ
Protective Barriers and Curtains (4.6.4)					•	•
Skin Protection (4.6.5)					X MPE	X MPE
Other Protective Equipment (4.6.5)	Use may be required					
Warning Signs and Labels (4.7) (Design Requirements)			•	•	X NHZ	X NHZ
Service and Repairs (4.8)	LSO Determination					
Modification of Laser Systems (4.9)	LSO Determination					

### Note 1. LEGEND

X: Shall

•: Should

---: No requirement

☆: Shall if enclosed Class 3b or Class 4

MPE: Shall if MPE is exceeded

NHZ: Nominal Hazard Zone analysis required

t: Applicable only to UV and IR Lasers (4.5.1.2)

2. LSO: Laser Safety Officer

An individual shall be designated the Laser Safety Officer with the authority and responsibility to monitor and enforce the control of laser hazards, and to effect the knowledgeable evaluation and control of laser hazards.

For your reference, see ANSI Z136.1-1993, Section 1.3.

# **Laser Product Classifications**

# EN

Class	Description			
Class 1	Lasers which are safe under reasonably foreseeable conditions of operation.			
Class 2	Lasers emitting visible radiation in the wavelength range from 400 nm to 700 nm. Eye protection is normally afforded by aversion responses including the blink reflex.			
Class 3A	Lasers which are safe for viewing with the unaided eye. For laser emitting in the wavelength range from 400 nm to 700 nm protection is afforded by aversion responses including the blink reflex. For other wavelengths the hazard to the unaide eye is no greater than for Class 1. Direct intrabeam viewing of Class 3A lasers with optical aides (e.g., binoculars, telescopes, microscopes) may be hazardous.			
Class 3B	Direct intrabeam viewing of these lasers is always hazardous. Viewing diffuse reflections is normally safe (see note).			
Class 4	Lasers which are also capable of producing hazardous diffuse reflections. They may cause skin injuries and could a constitute a fire hazard. Their use requires extreme caution.			


**Note:** Conditions for safe viewing of diffuse reflections for Class 3B visible lasers are: minimum viewing distance of 13 cm between screen and cornea and a maximum viewing time of 10 s. Other viewing conditions require a comparison of the diffuse reflection exposure with the MPE.

# Comparison of Classifications between FDA and ANSI

Class	FDA definition	ANSI description			
Class I/1	Limits applicable to devices that have emissions in the ultraviolet, visible, and infrared spectra, and limits below which biological hazards have not been established.	A Class 1 laser is considered to be incapable of producing damaging radiation levels during operation and maintenance and is, therefore, exempt from any control measures or other forms of surveillance.			
Class IIa/2a	Limits applicable to products whose visible emission does not exceed Class I limits for emission durations of 1,000 seconds or less and are not intended for viewing.	Class 2 lasers are divided into two subclasses, 2 and 2a. A Class 2 laser emits in the visible portion of the spectrum (0.4 to 0.7 $\mu m)$ and eye protection is normal-			
Class II/2	Limits applicable to products that have emissions in the visible spectrum (400 to 710 nm) for emission durations in excess of 0.25 second, providing that emissions for other durations and/or wavelengths do not exceed the Class I limits. Class II products are considered hazardous for direct long-term ocular exposure.	ly afforded by the aversion response including the blink reflex.			
Class IIIa/3a	Limits to products that have emissions in the visible spectrum and that have beams where the total collectable radiant power does not exceed 5 milliwatts.	Class 3 lasers are divided into two subclasses, 3a and 3b. A Class 3 laser may be hazardous under direct and specular reflection viewing conditions, but the diffuse			
Class IIIb/3b	Limits applicable to devices that emit in the ultraviolet, visible, and infrared spectra. Class IIIb products include laser systems ranging from 5 to 500 milliwatts in the visible spectrum. Class IIIb emission levels are ocular hazards for direct exposure throughout the range of the Class, and skin hazards at the higher levels of the Class.	reflection is usually not a hazard.			
Class IV/4	Exceeding the limits of Class IIIb and are a hazard for scattered reflection as well as for direct exposure.	A Class 4 laser is a hazard to the eye or skin from the direct beam and sometimes from a diffuse reflection and also can be a fire hazard. Class 4 lasers may also produce laser-generated air contaminants and hazardous plasma radiation.			

# **Label Indications**


# ● EN

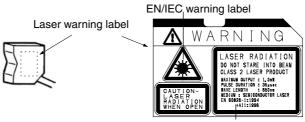

Explanatory label with specified wording

Note: Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

# FDA



# **Aperture Label**

# **Class II Caution logo type**





# **Certification and Identification Label**


This laser product compiles with 21 CFR 1040, 10 and 1040, 11.

OMECIA Corporation of the Compiles of the Comp


Note: Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

Dimensions (Unit: mm)

# ■ Sensor Heads (Diffuse Reflective)

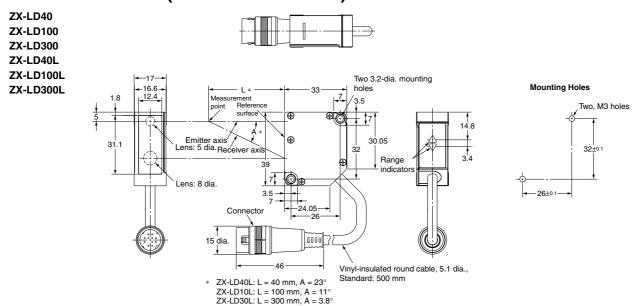


# ■ Sensor Heads (Regular Reflective)

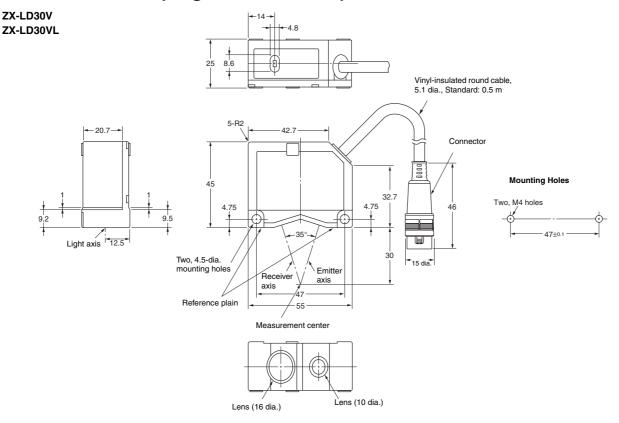

# ■ Sensor Heads (Through-beam)


# ZX-LT005 Emitter Two, 3.2 dia. Vinyl-insulated round cable (gray), 2.6 dia., 2.8 Standard: 500 mm Connector Laser ON indicator Light axis center Mounting Holes

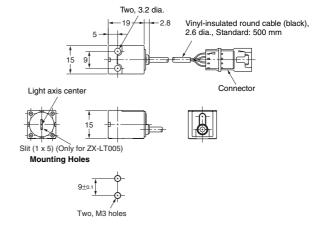



Receiver

# Sensor Head-Amplifier Unit Connecting Cable (Provided)


9±0.1



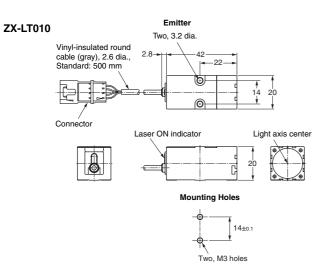


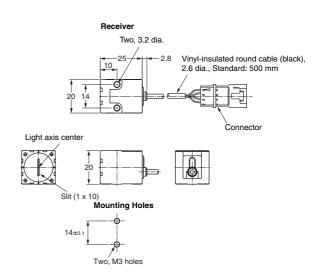


# Sensor Head-Amplifier Unit Connecting Cable (Provided)




# ZX-LT030

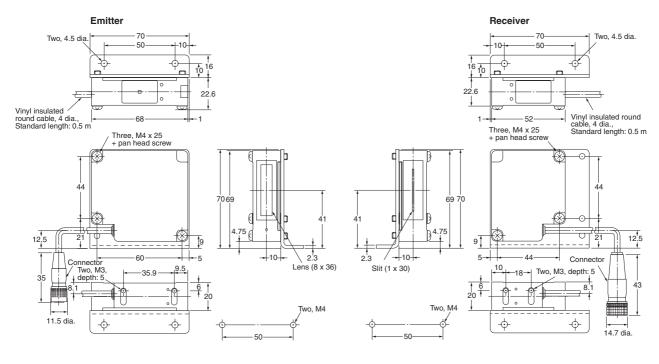

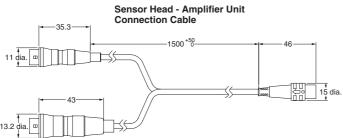


# **■** Amplifier Units




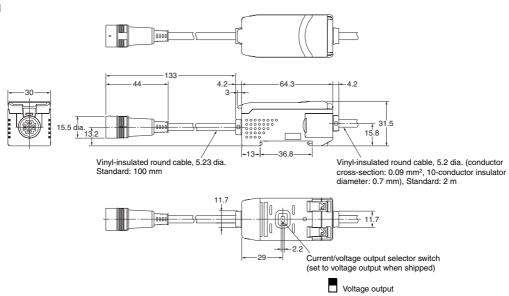


# ■ Accessories (Order Separately)

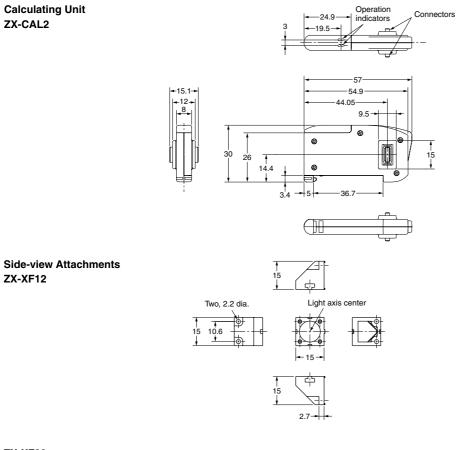

ZX-XF22

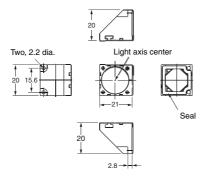

# ZX-series Communications Interface Unit ZX-SF11

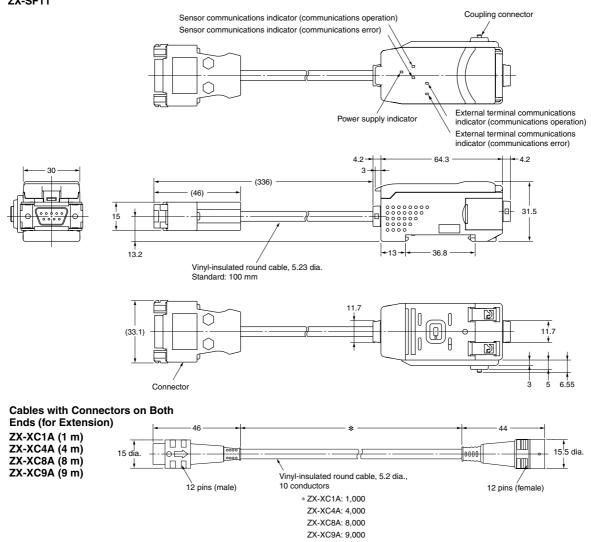



# ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.

To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.

This document provides information mainly for selecting suitable models. Please read the document Z197 carefully for information that the user must understand and accept before purchase, including information on warranty, limitations of liability, and precautions.

In the interest of product improvement, specifications are subject to change without notice.

# **OMRON Corporation**

**Industrial Automation Company** 

Sensing Devices Division H.Q. **Application Sensors Division** Shiokoji Horikawa, Shimogyo-ku, Kyoto, 600-8530 Japan Tel: (81)75-344-7068/Fax: (81)75-344-7107

### **Read and Understand This Catalog**

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments

# **Warranty and Limitations of Liability**

### WARRANTY

OMRON's exclusive warranty is that the products are free from defects in materials and workmanship for a period of one year (or other period if specified) from date of sale by OMRON.

OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, REGARDING NON-INFRINGEMENT, MERCHANTABILITY, OR FITNESS FOR PARTICULAR PURPOSE OF THE PRODUCTS. ANY BUYER OR USER ACKNOWLEDGES THAT THE BUYER OR USER ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE. OMRON DISCLAIMS ALL OTHER WARRANTIES, EXPRESS OR IMPLIED.

### LIMITATIONS OF LIABILITY

OMRON SHALL NOT BE RESPONSIBLE FOR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS, OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED ON CONTRACT, WARRANTY, NEGLIGENCE, OR STRICT LIABILITY.

In no event shall responsibility of OMRON for any act exceed the individual price of the product on which liability is asserted.

IN NO EVENT SHALL OMRON BE RESPONSIBLE FOR WARRANTY, REPAIR, OR OTHER CLAIMS REGARDING THE PRODUCTS UNLESS OMRON'S ANALYSIS CONFIRMS THAT THE PRODUCTS WERE PROPERLY HANDLED, STORED, INSTALLED, AND MAINTAINED AND NOT SUBJECT TO CONTAMINATION, ABUSE, MISUSE, OR INAPPROPRIATE MODIFICATION OR REPAIR.

# **Application Considerations**

### SUITABILITY FOR USE

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of products in the customer's application or use of the product.

At the customer's request, OMRON will provide applicable third party certification documents identifying ratings and limitations of use that apply to the products. This information by itself is not sufficient for a complete determination of the suitability of the products in combination with the end product, machine, system, or other application or use.

The following are some examples of applications for which particular attention must be given. This is not intended to be an exhaustive list of all possible uses of the products, nor is it intended to imply that the uses listed may be suitable for the products:

- · Outdoor use, uses involving potential chemical contamination or electrical interference, or conditions or uses not described in this catalog.
- Nuclear energy control systems, combustion systems, railroad systems, aviation systems, medical equipment, amusement machines, vehicles, safety
  equipment, and installations subject to separate industry or government regulations.
- Systems, machines, and equipment that could present a risk to life or property.

Please know and observe all prohibitions of use applicable to the products.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

# **Disclaimers**

### CHANGE IN SPECIFICATIONS

Product specifications and accessories may be changed at any time based on improvements and other reasons.

It is our practice to change model numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the product may be changed without any notice. When in doubt, special model numbers may be assigned to fix or establish key specifications for your application on your request. Please consult with your OMRON representative at any time to confirm actual specifications of purchased product.

# **DIMENSIONS AND WEIGHTS**

Dimensions and weights are nominal and are not to be used for manufacturing purposes, even when tolerances are shown.

# **ERRORS AND OMISSIONS**

The information in this catalog has been carefully checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical, or proofreading errors, or omissions.

### PERFORMANCE DATA

Performance data given in this catalog is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of OMRON's test conditions, and the users must correlate it to actual application requirements. Actual performance is subject to the OMRON Warranty and Limitations of Liability.

### **PROGRAMMABLE PRODUCTS**

OMRON shall not be responsible for the user's programming of a programmable product, or any consequence thereof.

### **COPYRIGHT AND COPY PERMISSION**

This catalog shall not be copied for sales or promotions without permission.

This catalog is protected by copyright and is intended solely for use in conjunction with the product. Please notify us before copying or reproducing this catalog in any manner, for any other purpose. If copying or transmitting this catalog to another, please copy or transmit it in its entirety.

2008.4



Компания «Океан Электроники» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

# Наши преимущества:

- Поставка оригинальных импортных электронных компонентов напрямую с производств Америки, Европы и Азии, а так же с крупнейших складов мира;
- Широкая линейка поставок активных и пассивных импортных электронных компонентов (более 30 млн. наименований);
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Помощь Конструкторского Отдела и консультации квалифицированных инженеров;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Поставка электронных компонентов под контролем ВП;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- При необходимости вся продукция военного и аэрокосмического назначения проходит испытания и сертификацию в лаборатории (по согласованию с заказчиком);
- Поставка специализированных компонентов военного и аэрокосмического уровня качества (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Actel, Aeroflex, Peregrine, VPT, Syfer, Eurofarad, Texas Instruments, MS Kennedy, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Компания «Океан Электроники» является официальным дистрибьютором и эксклюзивным представителем в России одного из крупнейших производителей разъемов военного и аэрокосмического назначения «JONHON», а так же официальным дистрибьютором и эксклюзивным представителем в России производителя высокотехнологичных и надежных решений для передачи СВЧ сигналов «FORSTAR».



**«JONHON»** (основан в 1970 г.)

Разъемы специального, военного и аэрокосмического назначения:

(Применяются в военной, авиационной, аэрокосмической, морской, железнодорожной, горно- и нефтедобывающей отраслях промышленности)

«**FORSTAR**» (основан в 1998 г.)

ВЧ соединители, коаксиальные кабели, кабельные сборки и микроволновые компоненты:

(Применяются в телекоммуникациях гражданского и специального назначения, в средствах связи, РЛС, а так же военной, авиационной и аэрокосмической отраслях промышленности).



Телефон: 8 (812) 309-75-97 (многоканальный)

Факс: 8 (812) 320-03-32

Электронная почта: ocean@oceanchips.ru

Web: http://oceanchips.ru/

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, д. 2, корп. 4, лит. А